

Home Report



**Eavern Commercial Road,
Oldmeldrum
Inverurie, AB51 0DT**

Eavern, Commercial Road,
Oldmeldrum, Inverurie, AB51 0DT

Price Over
£349,000

 4  3  3   189m² EPC **B** Council tax band **E**



Contact solicitor







Peterkins
(Property Sales) 60 Market Place
Inverurie
AB51 3XN

01467-672800

invprop@peterkins.com

<http://www.peterkins.com>



- Features**  Garage  Garden  Ground floor bedroom & bathroom
-  Self-contained annex  On street parking  Off street parking

Description

We are delighted to offer for sale this spacious **4/5 bedroom detached dwellinghouse** in the popular Village of Oldmeldrum within easy walking distance of the local schools, shops and amenities.

The property has spacious and versatile living and bedroom accommodation throughout, the ground floor comprises of an Entrance vestibule and Hallway, Lounge/Bedroom, Bedroom, Family Bathroom, Dining Kitchen and a Family room.

The upper floor comprises of a large landing/Study area, Shower room and two exceptionally spacious Bedrooms.

The annex is accessed from the Family Room in the main house as well as a door at the side of the property, it comprises of Lounge/Kitchen, Bedroom and an Ensuite shower room.

The property benefits from gas central heating, solar panels with 5kw battery storage and full double glazing.


Outside, there is a large driveway providing off street parking for several cars in front of the Single garage. The surrounding garden ground is fully enclosed making it ideal for a family with young children and/or pets.

Early viewing is highly recommended to see all this property has to offer.

Location: Oldmeldrum boasts a variety of local shops and amenities all of which are within walking distance of the property. The village has a nursery, primary school and secondary education is provided at Meldrum Academy all within the village. There is a local church and active community, with a good mix of young, old and families. In addition to this Oldmeldrum is only a short drive away from Inverurie, Dyce, Bridge of Don and Aberdeen making it an ideal location for commuting with public transport also available from the Village. There are also two golf courses and driving range facilities, bowling club, pleasure park and a plentiful range of activities for children of all ages. The Redgarth Hotel and Restaurant is also only a five-minute walk away.

Directions

Travelling from Inverurie, follow the B9170 towards Oldmeldrum, at the roundabout take the first exit continuing on the B9170 until reaching the next roundabout taking the third exit onto Colpy Road/Commercial Road. Continue along taking the second right into Westend Gardens where the property is located on the corner clearly identified by a Peterkins For Sale sign.

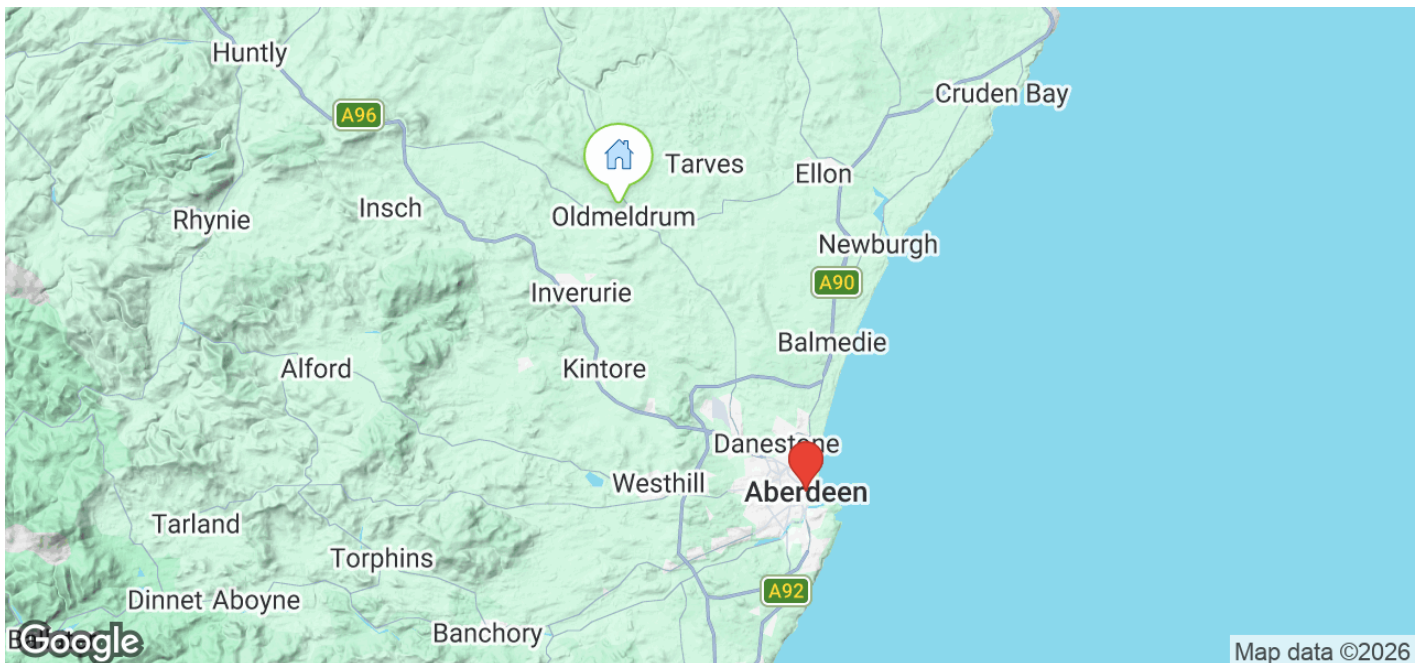

Accommodation comprises

(Ground Floor)

Entrance vestibule: Painted wooden door opens into the vestibule with a ceiling light; coat hooks and wood effect flooring.

Hallway: The welcoming hallway gives access to the Lounge, Bedroom, Family bathroom, Dining Kitchen and the staircase to the upper floor. Understairs cupboard providing great storage. Ceiling

light; smoke alarm; heating thermostat and wood effect flooring. Cupboard overhead housing consumer unit.

Lounge/Bedroom: 4.24m x 3.98m (13'11" x 13'1") approx. A good sized room currently used as a Lounge but could easily accommodate a double bed along with a range of freestanding furniture. Bay window to the front; ceiling light and carpet.

Bedroom: 4.01m x 3.20m (13'2" x 10'6") approx. A spacious double bedroom located to the rear of the property. Window with roman blind. Ceiling light and wood effect flooring.

Bathroom: The family bathroom comprises of a toilet, wall mounted vanity wash hand basin, bath and a large separate shower enclosure with a mains fed shower head. Splashback tiling throughout with aqua paneling in the shower area. Downlights; extractor fan; heated towel rail and opaque window with roller blind.

Kitchen Diner: 7.18m x 3.50m (23'7" at widest x 11'6" at widest) approx. Generous bright room with ample space for a large dining table and chairs in front of the large bay window filling the room with natural light. Lovely feature open décor fireplace with tiled inset and wooden mantel beam above and an alcove space beside with cupboard.

The kitchen is fitted with a range of base, wall and full height units with coordinating worktops. Two bowl stainless steel sinks with drainer, mixer tap and a window above with roman blind. Integrated double ovens and spaces plumbed for slot in dishwasher and stacked washing machine and tumble dryer. Space for American style fridge freezer. Benefitting from a matching Centre island providing great additional storage and worktop space with the electric hob set in.

Ceiling lights; smoke alarm and wood effect flooring. Door through to the Family room.

Family room: 3.25m x 2.74m (10'8" x 9'0") approx. Just off the kitchen, the family room is a good size and benefits from French doors that open onto the rear wooden deck. Ceiling light; smoke alarm and wood effect flooring.

(First Floor)

Carpeted staircase leads up: From the main hallway, the carpeted staircase leads to the upper floor landing giving access to the shower room and bedrooms. Large window; ceiling light; smoke alarm and book shelving.

Shower room: Fitted with a concealed cistern toilet, wash hand basin set on vanity storage unit and a large tiled shower enclosure with a rainfall head. Heated ladder towel rail; opaque window; downlights, extractor fan and wood effect flooring.

Play room/Study area: 4.24m x 4.19m (13'11" at widest x 13'9" at widest) approx. A good sized versatile room in between the two upstairs bedrooms. An ideal home office space with a window to the front and Velux to the rear providing natural light. Ceiling light; telephone point; smoke alarm and wood effect flooring.

Master Bedroom: 5.23m x 4.41m (17'2" x 14'6") approx. An exceptionally spacious master bedroom with ample space for a king, queen or double bed along with a range of freestanding furniture. Two large sloping windows, one of which is a balcony Velux, both with lovely views towards Bennachie along with a smaller Velux to the rear all with fitted blinds. Ceiling light; smoke alarm and wood effect flooring.

Bedroom: 6.07m x 3.91m (19'11" x 12'10" at widest) approx. Another generous bedroom completes the accommodation, again with ample space for a range of furniture. Window and two Velux with blinds. Ceiling light and carpet.

(Annex)

Adjoining annex: The annex is accessed from the Family room as well as an external door at the side of the property.

Dining Kitchen/Lounge: 4.85m x 4.54m (15'11" at widest x 14'11" at widest) approx. A bright room with a fitted kitchen and ample space for a range of lounge furniture including a dining table and chairs. The kitchen consists of a range of base and wall units with coordinating worktop. One and a half bowl composite sink with drainer and mixer tap. Integrated washing machine, electric hob and space for a standalone fridge freezer.

Large windows provide great natural light and overlook the garden. Part glazed door at the side for private access.

Ceiling lights; smoke alarm; telephone point; wood effect flooring with a smaller section of tile effect flooring at the kitchen area.

Annex bedroom: 2.87m x 2.64m (9'5" x 8'8") approx. The bedroom has space for a double bed along with further furniture. Benefitting from a built in wardrobe with sliding doors, hanging rails and shelving. Window; ceiling light; smoke alarm and wood effect flooring.

Ensuite Wet room: Comprising of a concealed cistern toilet, wash hand basin set on storage unit and a large open shower area with bench seating and an electric shower head. Bright white splashback tiling throughout with contrasting black worktop and tiled flooring. Opaque window; heated towel rail; ceiling light and extractor fan.

(Outside)

The large driveway provides off street parking for several cars and leads to the Single garage. The garage benefits from an electric roller door, power and light. There is a door at the rear for access from the garden as well. An EV Car Charger is located externally at the front of the property.

The surrounding garden ground is fully enclosed making it ideal for a family with children and/or pets. Established hedges provide great privacy around the front and side of the garden which is mostly laid to lawn with areas of patio and wooden decking providing lovely spots for family gatherings and entertaining. Concrete foundation in place suitable for a summerhouse or shed to the side.

Greenhouse and two storage sheds. Two outdoor taps; security lighting and power sockets.

Floorplan

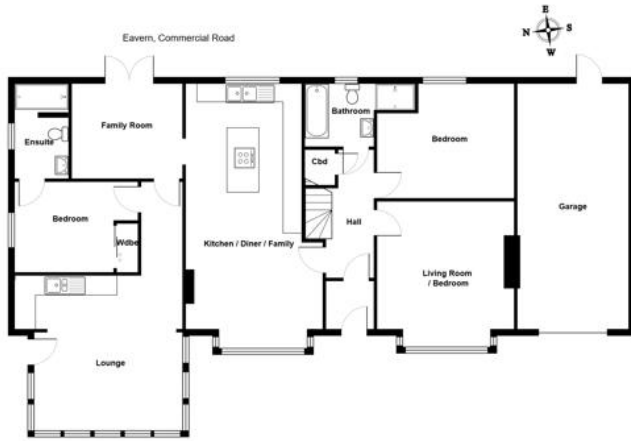


Photo gallery



View this property on [aspc.co.uk](https://www.aspc.co.uk):

<https://www.aspc.co.uk/search/property/439522/Eavern--Commercial-Road/Inverurie/>

The foregoing particulars are being distributed on behalf of the Selling Solicitors by Aberdeen Solicitors' Property Centre Ltd. of 2-10 Holburn Street, Aberdeen, AB10 6BT. Whilst the particulars have been prepared with care and are believed to be accurate, no liability for any errors or omissions therein or the consequences thereof will be accepted by the Selling Solicitors or Aberdeen Solicitors' Property Centre Ltd. © Aberdeen Solicitors' Property Centre and Selling Solicitors.

Broadband speed



Superfast

You can get up to **52 Mbps** average speed at this postcode.

Mobile coverage

	Indoor		Outdoor	
	Voice	Data	Voice	Data
EE	✓ Likely	✓ Likely	✓ Likely	✓ Likely
3	✓ Likely	✓ Likely	✓ Likely	✓ Likely
O2	✓ Likely	✗ Limited	✓ Likely	✓ Likely
vodafone	✗ Limited	✗ Limited	✓ Likely	✓ Likely

Ofcom

This information is a prediction and actual services may be different depending on my circumstances and precise location. Provided by Ofcom, last retrieved on 16/05/2025. 5G coverage is not included in this data.

The data displayed on broadband coverage availability uses source data from Ofcom. The predicted speeds provided in the API data are provided by the leading UK ISPs. We understand that Ofcom did not receive data for every premise in the UK, and that Ofcom continue to work with industry to fill in the gaps. If no predictions are shown for your address, this does not necessarily mean broadband is not available and we suggest that you check availability on the ISP websites.

The data displayed on mobile coverage availability uses source data made available by Ofcom which is based on data from the mobile operators about how strong they think signal levels are at every location in the UK. Each mobile operator has a slightly different approach to displaying coverage on its own map, including assumptions on the handsets used, levels of call reliability and the expected signal loss when indoors or in car. Because Ofcom brings all mobile operator data together in a single place and holds it to a single, independent standard, the mobile coverage availability information above may display different levels of coverage than those seen on the operators' websites. We would therefore recommend you also check the mobile provider's coverage checker. Mobile coverage data is created by coverage modelling, and since this is based on computer predictions is not error free.

Ofcom update the source data regularly (every month) and the mobile network operators update theirs, but there may be times when the maps are based on slightly different data and therefore show different coverage.

For further information about the Ofcom APIs, read their FAQs available here.

<https://www.ofcom.org.uk/siteassets/resources/documents/research-and-data/broadband-research/api-faqs?v=323603>

Eavern, Commercial
Road, Oldmeldrum,
Inverurie,
Aberdeenshire, AB51
ODT

Property Questionnaire

Property Address:

Eavern, Commercial Road, Oldmeldrum, Inverurie, Aberdeenshire, AB51 0DT

Seller(s):

Blaine Kent, Fiona Kent

Completion Date of Property Questionnaire: 03/02/2026

Note for sellers.

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

1. Length of ownership

How long have you owned the property? 13

2. Council Tax

Which Council Tax band is your property in? E

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	Yes	Allocated parking space	No	Driveway	Yes
Shared parking	No	On street	Yes	Resident permit	No
Metered parking	No	Other:			

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? No

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)? Yes

If you have answered yes, please describe the changes which you have made:

Large extension added to create a self contained annex to the property. Including the addition of a bathroom upstairs and increasing the 2nd floor to extend over the extension. The addition of a garage as well.

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? Yes

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property? Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced? No

(ii) Did this work involve any changes to the window or door openings? Yes

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):
Patio door added along with new windows fitted to the extension.

Please give any guarantees which you received for this work to your solicitor or estate agent.

7. Central Heating

A. Is there a central heating system in your property? Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air) System boiler with hot water cylinder

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed? 2015

C. Do you have a maintenance contract for the central heating system? No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old? Yes

9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it? No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property? No

If you have answered yes, please give details:

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	Octopus
Water mains/private water supply	Yes	Aberdeenshire council
Electricity	Yes	Octopus
Mains Drainage	Yes	Aberdeenshire council
Telephone	Yes	BT
Cable TV/Satellite	Yes	BT
Broadband	Yes	BT

- b. **Is there a septic tank system at your property?** No

If you have answered yes, please answer the two questions below:

- c. **Do you have appropriate consents for the discharge from your septic tank?**
- d. **Do you have a maintenance contract for your septic tank?**

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for a Shared or Common Areas

- a. **Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?** No

If you have answered yes, please give details:

- b. **Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?** No

If you have answered yes, please give details:

- c. **Has there been any major repair or replacement of any part of the roof during the time you have owned the property?** Yes

- d. **Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?** No

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** No

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** No

If you have answered yes, please give details:

12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. **Is there a common buildings insurance policy?** No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.**

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	No
(iv)	NHBC	No
(v)	Damp course	No

(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No
------	------------------------------------------------------------------------------------------------------------------	----

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

B. Are there any outstanding claims under any of the guarantees listed above? No

If you have answered yes, please give details:

15. Boundaries

So far as you are aware, has any boundary of your property been moved in the last 10 years? No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

a. Advising that the owner of a neighbouring property has made a planning application? No

b. That affects your property in some other way. No

c. That requires you to do any maintenance, repairs, or improvements to your property. No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Eavern,
Commercial Road,
Oldmeldrum,
Inverurie,
Aberdeenshire,
AB51 0DT

Home Report



DM HALL

Eavon,
Commercial Road,
Oldmeldrum,
Inverurie,
Aberdeenshire,
AB51 0DT

Single Survey



DM HALL

Survey Report on:

Property Address	Eavern, Commercial Road, Oldmeldrum, Inverurie, Aberdeenshire, AB51 0DT
Reference	1415567
Customer Name	Blaine Kent
Date of Inspection	6th February 2026
Surveyor's name, qualifications and office	Darroch Robertson BSc (Hons) MRICS DM Hall LLP Chartered Surveyors 64 Market Place Inverurie AB51 3XN Tel: 01467 624393 email: inverurieresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2- DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property is a one and a half storey detached house.
Accommodation	Ground Floor: Entrance Vestibule, Hallway, Living Room Room/ Bedroom 5, Bedroom 3, Bathroom, Dining Kitchen, Family Room, Sitting Room with Utility Area, Bedroom 4 with Ensuite Shower Room. First Floor: Landing/ Hallway with Study/ Sitting Area, Bedroom 1 and Bedroom 2.
Gross Internal Floor Area (m2)	Approximately 189m ² .
Neighbourhood and Location	The property forms part of an established residential area in the town of Oldmeldrum. The surrounding properties in the immediate vicinity are generally of a differing age and style. A range of typical local amenities can be found within the town.
Age	Built around 1950 and substantially altered and extended around 2020.
Weather	It was overcast with rain showers, following generally similar conditions.
Chimney Stacks	There are no chimney stacks.
Roofing including Roof Space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.

	<p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is pitched and concrete tiled, with concrete tile ridge and hips. There are flat roof dormer window projections to the front and rear. The front dormer roof appears to be overlaid in felt and the rear dormer in rubber sheeting. There are photovoltaic panels installed on the front and rear roof slopes.</p> <p>The flat roof of the front addition appears to be finished with rubber sheeting.</p> <p>A very limited inspection was possible of both the apex roof space at a small hatch in the first floor hall and into the rear eaves via a small hatch at the stair. The roof is of timber construction, with timber sarking. Where visible, insulation materials have installed at joist level.</p>
<p>Rainwater Fittings</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The gutters are of a PVC, half round design with PVC, round downpipes.</p>
<p>Main Walls</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls appear of solid block construction, externally roughcast and the addition walls appear of timber frame construction, with a block outer leaf externally. all have a roughcast finish.</p>
<p>Windows, External Doors and Joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where</p>

	<p>possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of a double glazed UPVC type. There are some double glazed roof light windows.</p> <p>The front access door is of a timber double glazed design. The annexe side access door is of a UPVC double glazed design. There are double glazed UPVC French doors.</p> <p>The soffits and fascias are formed in UPVC. There are timber and UPVC facings around dormer windows.</p>
External Decorations	<p>Visually inspected.</p> <p>The external timbers are finished in both paint and natural wood stain.</p>
Conservatories and Porches	<p>There are no conservatories or porches.</p>
Communal Areas	<p>There are no communal areas.</p>
Garages and Permanent Outbuildings	<p>Visually inspected.</p> <p>The property has a single integral garage. Vehicle access is via an electric roller door and there is a upvc pass door to the rear.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>The property has garden areas to the front, side and rear which are surfaced in grass, paving and planting. The boundaries are formed in timber fencing, block walls, metal fencing and hedging.</p> <p>There is a drive and parking area surfaced in chip stones, tarmac and concrete paving. There is a chip stone ramp up to the garage entrance door.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings are of plasterboard construction.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls are of plasterboard construction. There are areas of laminate panelling and tile wall finishes.</p>

<p>Floors including Sub-floors</p>	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are of suspended timber construction overlaid with chipboard and tongue and groove boarding.</p> <p>No sub floor access was available.</p> <p>All floors are covered.</p>
<p>Internal Joinery and Kitchen Fittings</p>	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors consist of a timber panel and flush timber type. The door facings and skirting boards are of a moulded timber, MDF style.</p> <p>The stairs are formed in timber with a timber handrail.</p> <p>The main kitchen is fitted with a range of base and wall mounted units with laminate worktops.</p> <p>The annexe utility area is fitted with a range of base and wall mounted units with laminate worktops.</p>
<p>Chimney Breasts and Fireplaces</p>	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>Chimney breasts are formed in brick or block. There is an opening for an imitation fireplace in the dining area. All other original fireplace openings have been blocked and removed.</p>
<p>Internal Decorations</p>	<p>Visually inspected.</p> <p>The internal walls and ceilings have a papered and painted</p>

	finish. The internal joinery is finished in paint.
Cellars	There are no cellars.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed. The electricity consumer unit is located in the hall at the high level cupboard beside the stair. The electricity meter is located in an external box. A range of 13amp sockets are distributed throughout the property.</p> <p>The electricity supply is supplemented by 13 No. photovoltaic panels installed on the front and rear roof slopes, which are also connected to a storage battery. There is also an EV charger on the front wall of the garage.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains gas supply installed. The gas meter is located in an external box.</p>
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is connected to the mains supply. Visible pipework is made with copper and PVC materials.</p> <p>The bathroom is fitted with a white suite containing a WC, wash hand basin, whirlpool type bath and shower cubicle with mixer shower.</p> <p>The shower room is fitted with a white suite containing a WC, wash hand basin and shower cubicle with mixer shower.</p>

	<p>A stainless steel sink unit is fitted within the kitchen plus plumbing for a washing machine and dishwasher.</p> <p>The annexe shower room is fitted with a white suite containing a WC, wash hand basin and shower cubicle with electric shower over.</p> <p>A composite sink unit is fitted within the annexe utility area.</p>
<p>Heating and Hot Water</p>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a gas fired, Worcester central heating boiler located within the garage. This supplies a system of steel panel radiators throughout the property. The boiler also supplies the domestic hot water via a hot water tank located in the the garage.</p> <p>The central heating system is controlled by a programmer, a room thermostat and thermostatic valves on radiators.</p>
<p>Drainage</p>	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is connected to the main sewer. There are upvc and cast iron drainage pipes.</p>
<p>Fire, Smoke and Burglar Alarms</p>	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke detectors fitted within the property.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>
<p>Any Additional Limits to Inspection</p>	<p>The property was occupied, fully furnished and all floors were covered. Consequently, my inspection of the flooring and other elements was restricted.</p>

In accordance with Health and Safety Guidelines, I have not disturbed insulation or furniture and floor coverings have not been moved. Where present, personal effects within cupboards and wardrobes have not been moved, therefore limiting my inspection.

I was unable to inspect the sub floor area as no suitable access hatch was available.

My physical inspection of the roof void areas was very restricted due to insulation material, stored items and the limited size of the space. As a result, the roof void areas were only viewed from the access hatches.

The dormer flat roof areas are not visible from ground level.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.


Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms

part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Sectional Diagram showing elements of a typical house

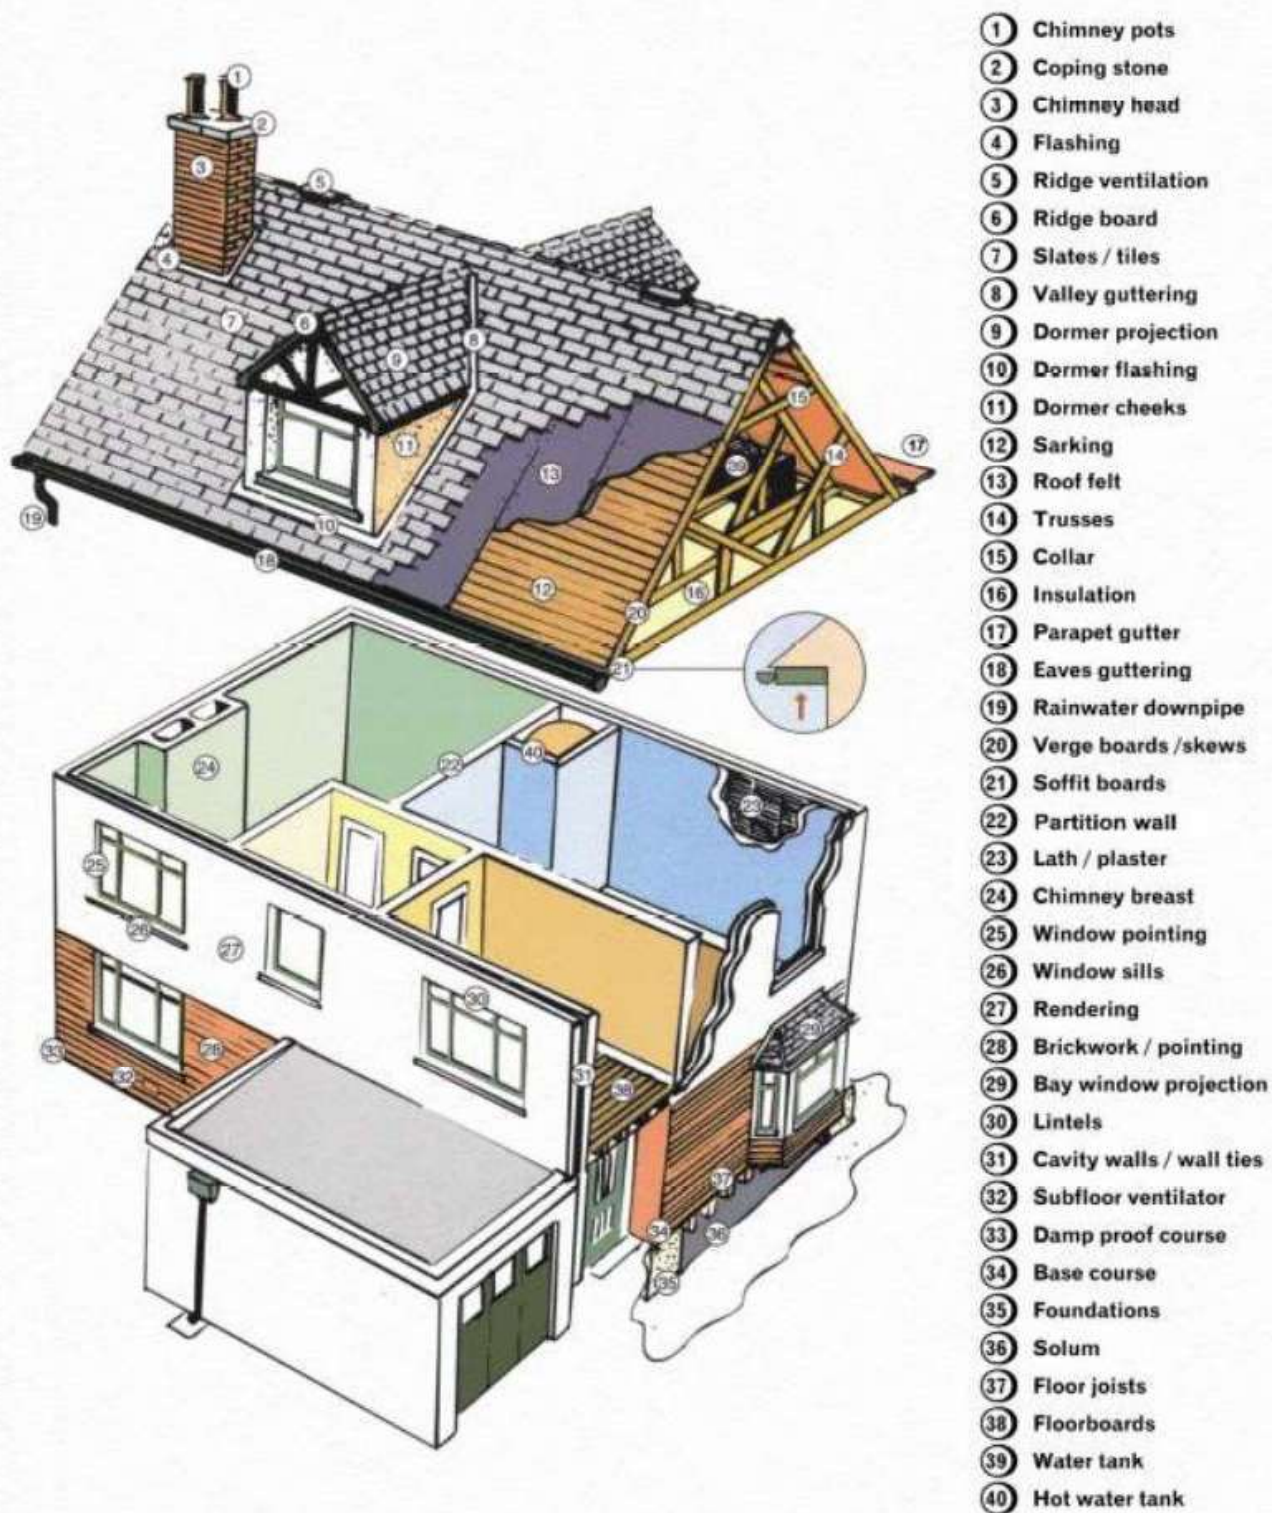

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, Rot and Infestation	
Repair Category	1
Notes	There is evidence of wood boring insect flight holes to old roof timbers which appear inactive. It is understood that previous timber specialist works have been carried out to the property under guarantee, and all relevant documentation should be transferred.

Chimney Stacks	
Repair Category	N/A
Notes	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space	
Repair Category	2
Notes	<p>The roofs of the dormers are of flat design. The front dormer appears to be clad with an older felt material, which is known to have a limited lifespan. Careful maintenance will be required as this type of roof covering can fail without warning. Periodic renewal of the roofing material is likely to be necessary. A roofing contractor can advise further.</p> <p>Elsewhere the tiled and rubber sheet roof coverings were replaced during the most recent extension and refurbishment works.</p> <p>There is a scattering of wood boring insect flight holes as well as historic staining/ deterioration to the remaining older roof timbers. Please see comments under Dampness, Rot & Infestation.</p> <p>Granular insulation, possibly Vermiculite, was evident in the rear eaves. Some older forms of this may contain asbestos. See information on Asbestos in the Limitations of Inspection section above.</p>

Rainwater Fittings	
Repair Category	1
Notes	No significant defects evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main Walls	
Repair Category	1
Notes	The roughcast of the outer wall and window sill to the rear of the kitchen is cracked. These areas can be sealed during routine maintenance to prevent water ingress which could lead to further deterioration.

Windows, External Doors and Joinery	
Repair Category	1
Notes	Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional. There is localised weathering to timber linings at the front dormer cheeks and localised damage to the front door frame.

External Decorations	
Repair Category	1
Notes	There are areas where decorations are becoming weathered and renewal of paintwork should be anticipated in places in due course.

Conservatories and Porches	
Repair Category	N/A
Notes	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Communal Areas	
Repair Category	N/A
Notes	Not Applicable

Garages and Permanent Outbuildings	
Repair Category	1
Notes	No significant defects evident.

Outside Areas and Boundaries	
Repair Category	1
Notes	The garden would benefit from a degree of maintenance.

Ceilings	
Repair Category	1
Notes	There is the odd blemish/ hairline crack was evident.

Internal Walls	
Repair Category	1
Notes	The odd blemish/ hairline crack was evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including Sub-floors	
Repair Category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. There are localised areas of creaky flooring.

Internal Joinery and Kitchen Fittings	
Repair Category	1
Notes	There are no doors at first floor landing and bedrooms. There is wear and tear to internal joinery finishes in places.

Chimney Breasts and Fireplaces	
Repair Category	1
Notes	Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation.

Internal Decorations	
Repair Category	1
Notes	Decorative finishes are worn in places and an incoming occupier can redecorate to their own personal taste.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not applicable.

Electricity	
Repair Category	1
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>Whilst the electricity consumer unit appears to be of a modern style, some older switch components remain in place. An NICEIC/SELECT registered electrician can be engaged to examine the system and implement all necessary upgrading works.</p>

Gas	
Repair Category	1
Notes	No significant defects evident. Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings

Repair Category	1
Notes	No significant defects evident.

Heating and Hot Water

Repair Category	1
Notes	<p>No significant defects evident. It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis.</p> <p>It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Drainage

Repair Category	1
Notes	No significant defects evident. There is localised corrosion to the cast iron section. This can be wire brushed and repainted to prolong its life span.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	1
Chimney Stacks	N/A
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	1
Windows, External Doors and Joinery	1
External Decorations	1
Conservatories and Porches	N/A
Communal Areas	N/A
Garages and Permanent Outbuildings	1
Outside Areas and Boundaries	1
Ceilings	1
Internal Walls	1
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	1
Internal Decorations	1
Cellars	N/A
Electricity	1
Gas	1
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed they meet the standards required by the Building Regulations or are exempt.

It is understood that timber/damp remedial works have taken place. It is assumed that appropriate guarantees exist and copies of all relevant documentation can be transferred and retained with the title deeds. This should be confirmed.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The full extent of the site and position of boundaries should be carefully checked with reference to the titles.

Estimated Reinstatement Cost (£) for Insurance Purposes

Five Hundred and Ten Thousand Pounds:
£510,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation (£) and Market Comments

Three Hundred and Fifty Thousand Pounds:
£350,000

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Report author:

Darroch Robertson BSc (Hons) MRICS

Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors 64 Market Place Inverurie AB51 3XN Tel: 01467 624393 email: inverurieresidential@dmhall.co.uk
Signed:	
Date of report:	6th February 2026

Eavern, Commercial Road,
Oldmeldrum, Inverurie,
Aberdeenshire, AB51 0DT

Mortgage Valuation Report



DM HALL

Property Address: Eavern, Commercial Road, Oldmeldrum, Inverurie, Aberdeenshire, AB51 0DT

Date of Inspection: 6th February 2026

Reference: 1415567

Location & Description

1. Location:

The property forms part of an established residential area in the town of Oldmeldrum. The surrounding properties in the immediate vicinity are generally of a differing age and style. A range of typical local amenities can be found within the town.

2. Description:

The property is a one and a half storey detached house.

3. Age:

Built around 1950 and substantially altered and extended around 2020.

4. Main Construction:

Walls: Solid concrete block and timber frame/ Roof: Pitched and tiled.
block.

5. Accommodation:

Ground Floor: Entrance Vestibule, Hallway, Living Room Room/ Bedroom 5, Bedroom 3, Bathroom, Dining Kitchen, Family Room, Sitting Room with Utility Area, Bedroom 4 with Ensuite Shower Room.

First Floor: Landing/ Hallway with Study/ Sitting Area, Bedroom 1 and Bedroom 2.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 189

Gross external floor area: 219

7. Garage and Outbuildings:

Single integral garage.

Services / Roads

8 Main Service:

Water: Yes: No:

Electricity: Yes: No:

Gas: Yes: No:

Drainage: Yes: No:

For comments on non-mains services, see section 15.

8a. Heating:

Gas fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None apparent.

Retention: Yes: No:

Retention amount:

11. Subsidence, Settlement and Landslip:

No obvious evidence of significant movement noted within the limitations of my inspection.

12. General Condition:

The property appeared to be in a condition generally consistent with its age, type and more recent alteration and extension works.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: No:

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

15. General Remarks:

It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed they meet the standards required by the Building Regulations or are exempt.

It is understood that timber/damp remedial works have taken place. It is assumed that appropriate guarantees exist and copies of all relevant documentation can be transferred and retained with the title deeds. This should be confirmed.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The full extent of the site and position of boundaries should be carefully checked with reference to the titles.

16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject, as always, to the policy of the individual lender.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Three Hundred and Fifty Thousand Pounds: £350,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Five Hundred and Ten Thousand Pounds: £510,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Darroch Robertson BSc (Hons) MRICS 1119355

Date: 6th February 2026

Office Address: DM Hall LLP Chartered Surveyors
64 Market Place
Inverurie
AB51 3XN

Tel: 01467 624393

email: inverurieresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

Energy Performance Certificate (EPC)

Scotland

Dwellings

Eavern , Commercial Road, Oldmeldrum, AB51 0DT

Dwelling type: Detached house
Date of assessment: 06 February 2026
Date of certificate: 11 February 2026
Total floor area: 189 m²
Primary Energy Indicator: 181 kWh/m²/year


Reference number: 0110-2676-2220-2906-1435
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,377	See your recommendations report for more information
Over 3 years you could save*	£1,863	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

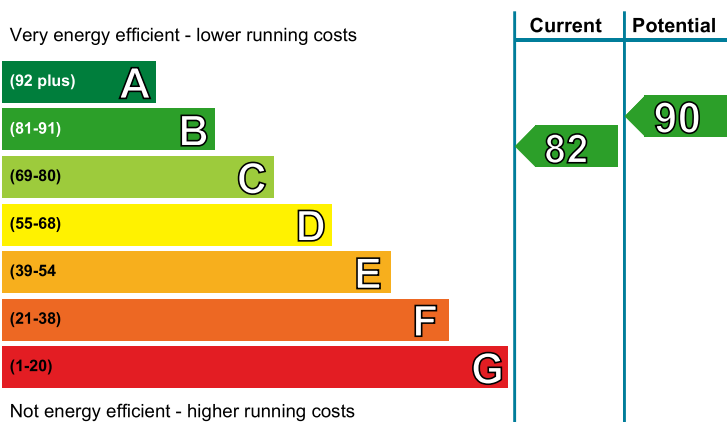


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (82)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

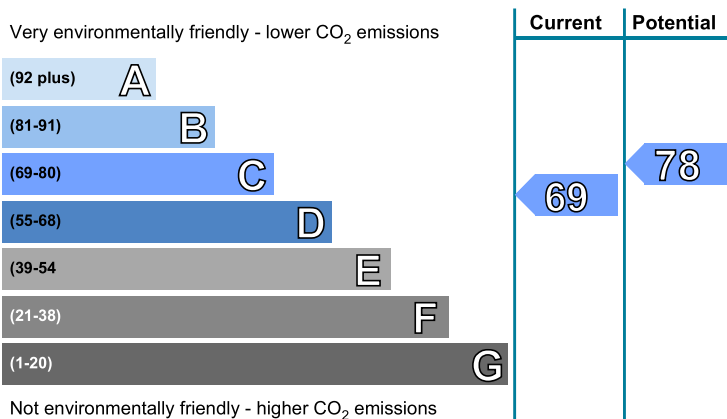

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (69)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£900 - £1,200	£792.00
2 Internal wall insulation	£7,500 - £11,000	£573.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£495.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	Pitched, insulated (assumed)	★★★★★	★★★★★
	Roof room(s), ceiling insulated	★★☆☆☆	★★☆☆☆
	Roof room(s), insulated (assumed)	★★★★★	★★★★★
Floor	Suspended, no insulation (assumed)	—	—
	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★★☆☆	★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 34 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.







Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,171 over 3 years	£4,305 over 3 years	
Hot water	£870 over 3 years	£873 over 3 years	
Lighting	£336 over 3 years	£336 over 3 years	
Totals	£7,377	£5,514	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£900 - £1,200	£264		
2 Internal wall insulation	£7,500 - £11,000	£191		
3 Floor insulation (suspended floor)	£5,000 - £10,000	£165		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Solar photovoltaics

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	25,767.9	N/A	N/A	N/A
Water heating (kWh per year)	3,160.09			

Addendum

The assessment does not include any feed-in tariffs that may be applicable to this property.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Darroch Robertson
Assessor membership number:	EES/009448
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	64 Market Place Aberdeenshire Inverurie AB51 3XN
Phone number:	0131 477 6000
Email address:	dmhall@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

