

peterkins

Home Report



Drewanlea Oyne,
Insch, AB52 6QR

Drewanlea, Oyne,

Insch, AB52 6QR

Price Over

£290,000

 **4**
 **2**
 **3**

 **145m²**
 **D**
 **F**



Contact seller
07717 143534

Contact solicitor
Peterkins
(Property Sales) 60 Market Place
Inverurie
AB51 3XN

01467-672800

invprop@peterkins.com

<http://www.peterkins.com>



- Features**
-  Garage
 -  Garden
 -  Ground floor bedroom & bathroom
 -  Off street parking

Description

We are pleased to offer for sale Drewanlea, a **3/4 bedroom detached bungalow** situated on a good sized plot, with stunning views towards Bennachie on the outskirts of the village of Oyne. The spacious living and bedroom accommodation comprises of lounge, master bedroom with en-suite, two double bedrooms, bathroom, dining kitchen, conservatory, wet room and office/bedroom 4. The property benefits from oil central heating, solar panels and full double glazing. Externally, there is a large driveway providing ample off street parking in front of the double garage, an extensive workshop, along with another wooden garage and storage sheds all providing a range of business opportunities and great storage spaces. There are also well-maintained garden grounds to both the front and rear of the property. Early viewing is highly recommended to appreciate all this property has to offer.

Location Oyne has a lively community with village hall and primary school and school transport to the Secondary education at either Inverurie Academy or Gordon Schools in Huntly. The Blue Roof Gallery is

within walking distance of the property. Further local amenities include a medical centre, leisure centre, post office, bakery and further shops which lie just a few minutes' drive away in the village of Inch. Alternatively, a larger range of amenities and shops are available 10 minutes away in Inverurie. Transport links by rail from either Inch or Inverurie and bus links from the village are provided on a regular basis.

Directions

Follow the A96 north of Inverurie to the Oyne fork, taking the left fork towards Inch. Passing through the hamlet of Kirkton of Oyne and into the Village of Oyne, continue along this road heading towards Inch. Pass the turn off sign posted Back of Bennachie and Drewanlea is the first property located on the right hand side clearly identified by a Peterkins For Sale Sign.



Accommodation comprises

Entrance Hallway: Entered through a part glazed wooden door, the entrance hallway gives access to the inner hall. Ceiling light fitment and completed with laminate wooden flooring.

Inner Hallway: The inner hallway gives access to the lounge, 3 bedrooms, bathroom and dining kitchen. Ceiling light fitments, access hatch to loft which is partially floored with "Ramsay" ladder, smoke alarm, window to front with blinds, telephone point and completed with laminate wooden flooring.

Lounge: 5.71m x 4.52m (18'9" x 14'10") approx. Accessed via a part glazed wooden door, the bright and spacious lounge is located to the front of the property with large window providing stunning views towards Bennachie, along with a further window to the side which floods the room with natural light. Blinds and curtains. Ceiling light fitment with ceiling rose, coving, wall lights, television and telephone points and carpet.

Master Bedroom: 3.78m x 3.32m (12'5" x 10'11") approx. The spacious master bedroom is located at the end of the hallway with window to front with curtains providing lovely views towards Bennachie. Built in wardrobe with sliding mirrored doors and hanging rail which provides great additional storage. Ample space for a double bed, along with a range of free standing furniture. Ceiling light fitment, wooden door leads through to the en-suite and completed with laminate wooden flooring.

En-Suite: Fitted with a white 2 piece suite comprising of wall hung wash hand basin set within vanity unit with storage below, W.C. with concealed cistern and walk in shower. Aqua paneled to full height around entire room. Ceiling light fitment, extractor fan, shaver point and wooden flooring.

Bedroom: 3.42m x 3.27m (11'3" x 10'9") approx. Another good sized double bedroom located to the rear of the property with window and blinds. Built in wardrobe with sliding mirrored doors provides great additional storage. Ceiling light fitment, ample space for a double bed, along with a range of free standing furniture, telephone point and laminate wooden flooring.

Bedroom: 3.25m x 2.79m (10'8" x 9'2") approx. Spacious double bedroom also located to the rear of the property with window and blinds. Built in wardrobe with sliding mirrored doors providing great additional storage. Ceiling light fitment, wall lights and carpet.

Bathroom: Fitted with a 3 piece suite comprising of W.C, wash hand basin and bath with shower attachment above. Tiled to dado height around most of the room and aqua paneled to full height behind bath and shower. Ceiling light fitment, extractor fan, opaque glazed window to rear and laminate wooden flooring.

Dining Kitchen: 4.52m x 3.91m (14'10" x 12'10") approx. The generous sized dining kitchen is fitted with a range of base, wall, drawer and corner display units with coordinating worktop and tiled splashback. Space for standalone cooker and 1 1/2 bowl sink with drainer and mixer tap. Strip light, extractor fan and separate island providing additional storage and worktop space with breakfast bar seating for 2. Sliding glass doors gives access to the Sun Room with further part glazed door leading to the rear hallway. Television point and completed with wooden flooring.

Sun Room: 4.19m x 3.63m (13'9" x 11'11") approx. The bright and airy sun room is located to the front of the property with large window with blinds providing stunning views towards Bennachie. Ceiling light fitment, ample space for a dining table and chairs, television point and wooden flooring.

Rear Hallway: Located off the dining kitchen, the rear hallway gives access to bedroom/office and wet room. Part glazed wooden door gives access to the rear garden and a further part glazed wooden door also leads out to the front. Large pantry cupboard with shelving and lighting which also provides great additional storage, along with a further cupboard which houses the central heating boiler. Ceiling light fitments, coat hooks and tile effect vinyl flooring.

Wet Room: Fitted with a 2 piece suite comprising W.C, wash hand basin and electric shower. Ceiling light fitment, extractor fan, shaver point, aqua paneled to full height around entire room and completed with tiled flooring.

Office/Bedroom: 3.65m x 2.81m (12' x 9'3") approx. Completing the accommodation is the office space which is of good size and is fitted with base and wall storage making the property ideal for someone who works from home or otherwise wishes to run a business from the property. Alternatively, the office could be used as a bedroom. Strip light, telephone points and completed with carpet tiles.

(Outside)

To the front of the property there is a large driveway providing off street parking for several cars in front of the double garage. The double garage is accessed via up and over doors and benefits from power, light and a partially floored storage area above which is accessed via "Ramsay" ladder. Further storage area to the rear of the garage which has shelving, window to rear and a door that leads to the rear garden. An area laid to lawn with shrubs and plants. Paved pathway leads along the side of the property and gives access to the rear garden. The rear garden is mainly laid to lawn. Rotary clothes dryer. Doors give access to the rear of the garage and the rear door of the property. Double metal gates give access to a further area of parking which gives access to a variety of outbuildings. The



exceptionally large workshop measures at approx. 30m x 6m and is accessed via 3 sliding wooden doors, the first area benefits from a toilet and wash hand basin, along with a storage area. There is also a further wooden garage, wooden shed which both benefit from power and light and a log store. The range of outbuildings this property has to offer makes it ideal for someone looking to run their business from home or has a particular interest/hobby that requires ample storage. There is a further area laid to grass with mature shrubs and bushes. Further double metal gates lead onto the road.

Floorplan

Drawings, Oyne



Photo gallery

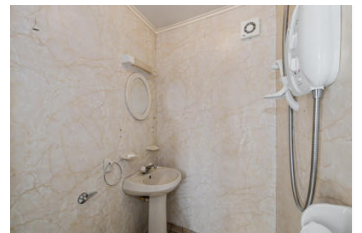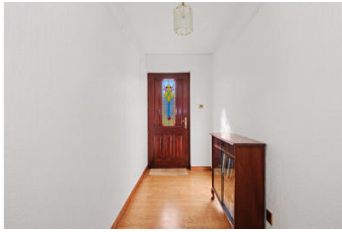

View this property on [aspc.co.uk](https://www.aspc.co.uk):

<https://www.aspc.co.uk/search/property/440910/Drewanlea--Oyne/Insch/>

The foregoing particulars are being distributed on behalf of the Selling Solicitors by Aberdeen Solicitors' Property Centre Ltd. of 2-10 Holburn Street, Aberdeen, AB10 6BT. Whilst the particulars have been prepared with care and are believed to be accurate, no liability for any errors or omissions therein or the consequences thereof will be accepted by the Selling Solicitors or Aberdeen Solicitors' Property Centre Ltd. © Aberdeen Solicitors' Property Centre and Selling Solicitors.





















Broadband speed



Superfast

You can get up to **37 Mbps** average speed at this postcode.

Mobile coverage

	Indoor		Outdoor	
	Voice	Data	Voice	Data
	 No signal	 No signal	 Likely	 Likely
	 Limited	 Limited	 Likely	 Likely
	 Limited	 No signal	 Likely	 Likely
	 Limited	 No signal	 Likely	 Likely

Ofcom

This information is a prediction and actual services may be different depending on my circumstances and precise location. Provided by Ofcom, last retrieved on 16/05/2025. 5G coverage is not included in this data.

The data displayed on broadband coverage availability uses source data from Ofcom. The predicted speeds provided in the API data are provided by the leading UK ISPs. We understand that Ofcom did not receive data for every premise in the UK, and that Ofcom continue to work with industry to fill in the gaps. If no predictions are shown for your address, this does not necessarily mean broadband is not available and we suggest that you check availability on the ISP websites.

The data displayed on mobile coverage availability uses source data made available by Ofcom which is based on data from the mobile operators about how strong they think signal levels are at every location in the UK. Each mobile operator has a slightly different approach to displaying coverage on its own map, including assumptions on the handsets used, levels of call reliability and the expected signal loss when indoors or in car. Because Ofcom brings all mobile operator data together in a single place and holds it to a single, independent standard, the mobile coverage availability information above may display different levels of coverage than those seen on the operators' websites. We would therefore recommend you also check the mobile provider's coverage checker. Mobile coverage data is created by coverage modelling, and since this is based on computer predictions is not error free.

Ofcom update the source data regularly (every month) and the mobile network operators update theirs, but there may be times when the maps are based on slightly different data and therefore show different coverage.

For further information about the Ofcom APIs, read their FAQs available here.

<https://www.ofcom.org.uk/siteassets/resources/documents/research-and-data/broadband-research/api-faqs?v=323603>

Drewanlea, INSCH,
AB52 6QR

Property Questionnaire

Property Questionnaire

Property Address:

Drewanlea, INSCH, AB52 6QR

Seller(s):

Peterkins Inverurie

Completion Date of Property Questionnaire: 29/03/2026

Note for sellers.

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

Property Questionnaire

1. Length of ownership

How long have you owned the property? 5 years

2. Council Tax

Which Council Tax band is your property in? F

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	Yes	Allocated parking space	Yes	Driveway	Yes
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:			

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? No

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

Property Questionnaire

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)? No

If you have answered yes, please describe the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property? No

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

Property Questionnaire

7. Central Heating

A. Is there a central heating system in your property? Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air) oil

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed? 1970s

C. Do you have a maintenance contract for the central heating system? No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

Property Questionnaire

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old? No

9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it? No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property? No

If you have answered yes, please give details:

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	No	
Water mains/private water supply	Yes	private
Electricity	Yes	scottish power
Mains Drainage	No	
Telephone	Yes	BT
Cable TV/Satellite	Yes	freeview
Broadband	Yes	EE

Property Questionnaire

- b. Is there a septic tank system at your property? Yes

If you have answered yes, please answer the two questions below:

- c. Do you have appropriate consents for the discharge from your septic tank? Yes

- d. Do you have a maintenance contract for your septic tank? No

If you have answered yes, please give details of the company with which you have a maintenance contract: n/a

11. Responsibilities for a Shared or Common Areas

- a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? No

If you have answered yes, please give details:

- b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? No

If you have answered yes, please give details:

- c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property? No

- d. Do you have the right to walk over any of your neighbours property - for example to put out your rubbish bin or to maintain your boundaries? No

If you have answered yes, please give details:

Property Questionnaire

- e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? No

If you have answered yes, please give details:

- f. As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) No

If you have answered yes, please give details:

12. Charges associated with your property

- a. Is there a factor or property manager for your property? No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. Is there a common buildings insurance policy? Yes

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? no

- c. Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? No

Property Questionnaire

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	No
(iv)	NHBC	No
(v)	Damp course	No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No

Property Questionnaire

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** No

If you have answered yes, please give details:

15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. Advising that the owner of a neighbouring property has made a planning application?** No
- b. That affects your property in some other way.** No
- c. That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Drewanlea,
INSCH,
AB52 6QR

Home Report



DM HALL

Drewanlea,
INSCH,
AB52 6QR

Single Survey



DM HALL

Survey Report on:

Property Address	Drewanlea, INSCH, AB52 6QR
Reference	1507967
Customer Name	Derek Lawrence
Date of Inspection	6th April 2026
Surveyor's name, qualifications and office	Blair Stephen AssocRICS DM Hall LLP Chartered Surveyors 64 Market Place Inverurie AB51 3XN Tel: 01467 624393 email: inverurieresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2- DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property is a detached bungalow.
Accommodation	Ground Floor:- Entrance Vestibule, Inner Hallway, Rear Vestibule, Rear Hallway, Bathroom, Shower Room, Living Room, Sun Room, Kitchen, Main Bedroom with Ensuite Shower Room, two further Bedrooms, and Office.
Gross Internal Floor Area (m2)	Approximately 145m ² .
Neighbourhood and Location	<p>The property is located in a rural area near the village of Oyne. The property is surrounded by open countryside and farmland. A limited range of facilities and amenities can be found in the immediate area, with a wider range available in the nearby village of Insch and the town of Inverurie.</p> <p>There is a railway line adjacent to the rear boundary, whilst the B9002 route runs along the front boundary. A degree of noise/vibration from these could be anticipated.</p> <p>There is a timber electrical pylon on the property, with overhead electrical cables traversing the site.</p>
Age	Originally built around 1970.
Weather	It was sunny and dry, following generally mixed weather conditions.
Chimney Stacks	There are no chimney stacks.

Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is of a pitched timber construction, comprising timber roof trusses overlaid with timber board sarking, externally clad with concrete tiles. The ridge is tiled, with valleys and flashings formed in metal. Access to the main roof space was possible via a pull down ladder from a ceiling hatch access point to the hallway. Insulation has been laid between the ceiling joists and the area has been partly floored. No access was possible to any roof voids above the Sun Room extension.</p> <p>The roof to the rear extension is of a flat type, externally clad with a gravelled bituminous felt. There is no access to any roof voids of the flat roof extension.</p>
Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater conductors are of a PVC construction with ogee design guttering and box downpipes.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls appear to be of a cavity concrete block construction, rendered externally with a synthetic stone base course.</p> <p>The extension to the rear appears to be of a concrete block construction, rendered externally.</p>
Windows, External Doors and Joinery	<p>Internal and external doors were opened and closed where keys were available.</p>

	<p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of double glazed, timber frame type.</p> <p>The front and side access doors are of a timber single glazed stained glass design. The rear access door is of a timber double glazed design. There are double glazed UPVC sliding patio doors leading from the sun room to the garden.</p> <p>The soffits and fascias are formed in timber.</p>
External Decorations	<p>Visually inspected.</p> <p>The external timbers are painted.</p>
Conservatories and Porches	<p>There are no conservatories or porches.</p>
Communal Areas	<p>There are no communal areas.</p>
Garages and Permanent Outbuildings	<p>Visually inspected.</p> <p>The property has a double attached garage of concrete block construction under a pitched and tiled roof. There is a store to the rear under a flat bituminous felt roof. Vehicle access is via dual fibreglass doors, whilst there is a door to the rear store leading from the rear garden.</p> <p>There is a detached workshop of concrete block/panel construction, under a pitched roof externally clad with mixed corrugated metal and fibrous cement sheets. There are multiple pedestrian and access doors. There is power, light, and water.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>The property has garden areas to the front, side and rear, whilst there is an access path to the side. The garden areas are mainly surfaced in grass.</p> <p>The boundaries are formed in timber fencing, timber and wire fencing, and block walls, with some sections incorporating fibrous cement sheeting. There is a metal gate between the yard and the main house, whilst there is a timber gate leading from the yard to the main road.</p> <p>There is a drive and parking area surfaced in tarmac, with</p>

	<p>the yard surfaced in concrete.</p> <p>There are mature trees on site.</p> <p>There is a timber electrical pylon on the property, with overhead electrical cables traversing the site.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings are formed in plasterboard.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls are lined with plasterboard.</p> <p>There are areas of timber panelling, tile wall finishes and PVC wet wall finishes.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are of suspended timber construction.</p> <p>Access to the sub-floor is available via three floor hatches located in the rear hallway. This shows a sealed solum with adequate clearance beneath the joists. The hatch behind the side entrance door was jammed and could not be opened.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors consist of a timber panel and timber-glazed type.</p>

	<p>The door facings and skirting boards are of a timber style.</p> <p>The kitchen is fitted with a range of base and wall mounted units with laminate worktops.</p>
Chimney Breasts and Fireplaces	There are no chimney breasts/fireplaces.
Internal Decorations	<p>Visually inspected.</p> <p>The internal walls and ceilings have a papered and painted finish.</p>
Cellars	There are no cellars.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed. A range of mainly 13amp sockets are distributed throughout the property, with a round pin socket noted in the kitchen.</p> <p>The electricity fuse boxes are located at high level to the rear hall. The meters are located in the workshop, separate meters for the house and workshop.</p>
Gas	There is no gas supply.
Water, Plumbing and Bathroom Fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The owner has advised that water is from a private supply. The water filtration system is located within the the rear hall cupboard.</p> <p>Visible pipework is made with copper and PVC materials.</p> <p>The bathroom is fitted with a WC, wash hand basin and bath with mixer shower over.</p> <p>The ensuite shower room is fitted with a WC, wash hand basin and shower cubicle with mixer shower over.</p>

	<p>The wet room to the rear extension is fitted with a WC, wash hand basin and electric shower over.</p> <p>A composite sink unit is fitted within the kitchen.</p>
<p>Heating and Hot Water</p>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is an oil fired, 'Worcester Greenstar Danesmoor Utility 18/25 ErP+' central heating boiler located within the rear hallway cupboard. This supplies a system of radiators throughout the property. There is an 'Ultima Solar M-200 E' hot water tank located in the rear cupboard.</p> <p>The central heating system is controlled by a programmer, a room thermostat and thermostatic valves on radiators.</p>
<p>Drainage</p>	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>The owner has advised that drainage is to a private septic tank located within the site. This has not been inspected or tested.</p>
<p>Fire, Smoke and Burglar Alarms</p>	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Any Additional Limits to Inspection</p>	<p>The property was unoccupied, partly furnished and floors were covered.</p> <p>The physical inspection of the roof void area was restricted due to insulation materials, stored items, and partial flooring.</p> <p>My inspection of the subfloor was restricted to the rear hallway hatches. The hatch behind the side entrance door could not be opened.</p> <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation we have assumed that there is no Japanese</p>

Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.


Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Sectional Diagram showing elements of a typical house

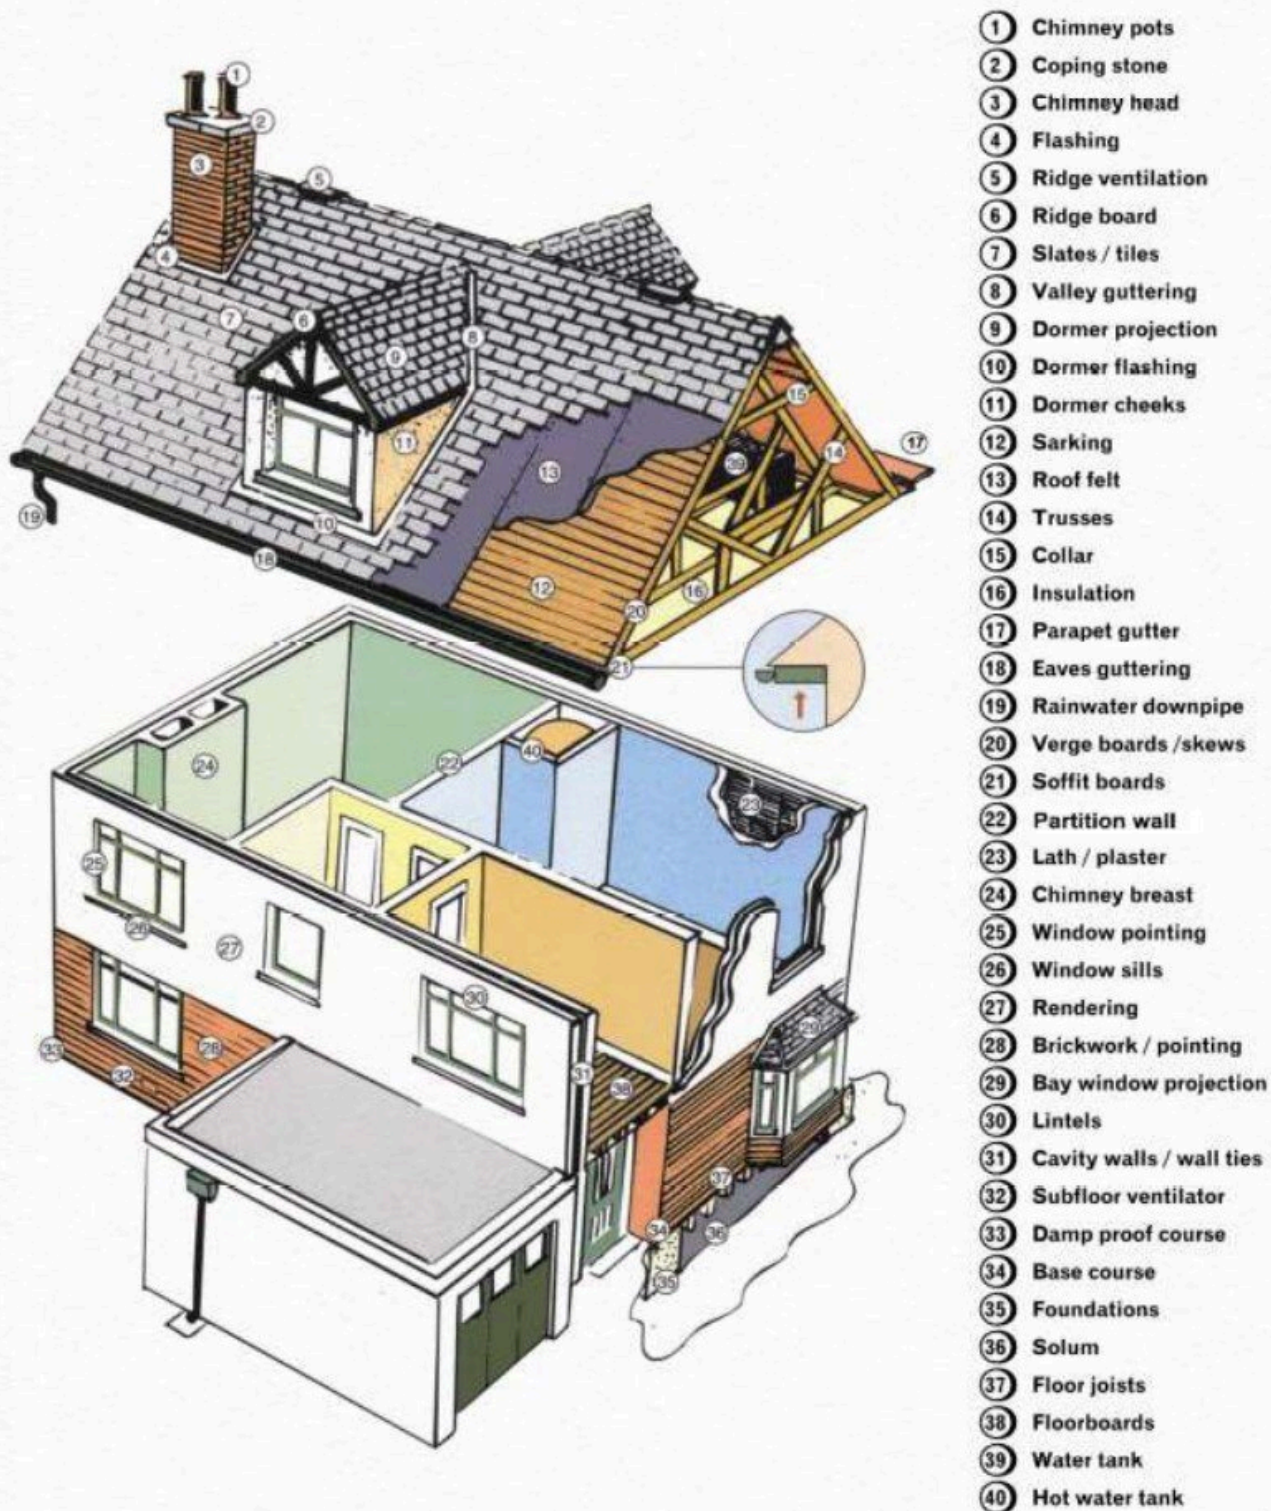

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	No obvious evidence of significant movement noted within the limitations of the inspection.

Dampness, Rot and Infestation	
Repair Category	1
Notes	At the time of our inspection active woodworm was noted to the pull down loft ladder and stored items sitting atop chipboard sheeting in the roof space. The seller has advised that woodworm treatment has subsequently been undertaken under long term guarantee. A conveyancer could inspect the guarantee and provide further advice.

Chimney Stacks	
Repair Category	N/A
Notes	Not applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space

Repair Category	2
Notes	<p>Please see comments above under 'Dampness, Rot and Infestation'.</p> <p>Externally there is moss to the roof tiles. Internally there is condensation staining to the roofing timbers, with some rusty nail ends visible. Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and if any repairs may be required.</p> <p>The fibrous cement sheeting to the dry verges may contain asbestos based materials. See information on Asbestos in the limitations of inspection section above.</p> <p>There is evidence of previous mice activity in the roof space.</p> <p>The roof of the rear extension is of flat design and clad with an older gravelled bituminous felt material which is known to have a limited lifespan. Careful maintenance will be required as this type of roof covering can fail without warning. Periodic renewal of the roofing material is likely to be necessary. A roofing contractor can advise further.</p>

Rainwater Fittings

Repair Category	1
Notes	<p>No significant defects evident. However, the effectiveness of the rainwater fittings cannot be commented on as it was not raining. Heavy rainfall can often reveal localised leakage and the need for maintenance attention.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main Walls	
Repair Category	1
Notes	The external walls are in a condition consistent with their age and type of construction, with some weathering to the external render.

Windows, External Doors and Joinery	
Repair Category	2
Notes	<p>The seals of double glazed units have failed, resulting in condensation between the panes of glass. These units can be repaired/replaced by a glazing contractor.</p> <p>Some of the windows are troublesome to open and close, whilst the locking mechanism to the sun room requires repair.</p> <p>The window units are of an older type. It could be anticipated that an incoming occupier may wish to undertake upgrades.</p> <p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p>

External Decorations	
Repair Category	1
Notes	<p>No significant defects evident.</p> <p>Regular repainting is required to maintain an attractive appearance and to prevent deterioration of external timbers.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories and Porches

Repair Category	N/A
Notes	Not applicable.

Communal Areas

Repair Category	N/A
Notes	No significant defects evident.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and Permanent Outbuildings

Repair Category	2
Notes	<p>The double car garage is in a condition consistent with its age and type of construction. There is corrosion to the steel beams, whilst the owner has advised that the automatic door openers require repair. The store to the rear is under a flat bituminous felt roof which will require ongoing maintenance and repair.</p> <p>The workshop is in a condition consistent with its age and a relatively basic type of construction. This displays common age related defects including, for example, a bow/staining to the roofing timbers which have been buttressed in sections, damage to the concrete panels, and corrosion to the metal doors. A builder could inspect the workshop and provide a comprehensive report on the condition and the costs of all necessary repairs, prior to purchase.</p> <p>The electrical installation to the workshop is dated and industrial in nature. An NICEIC/SELECT registered electrician can be engaged to examine the system and provide further advice as to the cost of implement all necessary upgrading works, prior to purchase.</p> <p>The outbuilding may contain asbestos based materials. See information on Asbestos in the Limitations of Inspection section above.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside Areas and Boundaries	
Repair Category	2
Notes	<p>At the time of my inspection there was evidence of the burning of waste materials on site, including what appears to be timbers and metal pots/drums, whilst there were pieces of damaged asbestos sheeting adjacent. The owner could confirm the exact nature of what materials were previously burned on site and has advised that the area shall be cleared of all debris, including broken asbestos, prior to sale. See information on Asbestos in the limitations of inspection section above.</p> <p>There are red diesel tanks adjacent to the workshop. A specialist contractor could inspect and confirm they would comply with current regulations and remain suitable for use, prior to their usage by an incoming occupier.</p> <p>The boundary walls are in a condition consistent with their age and type of construction and are partly retaining in nature. There is evidence of movement and damaged/cracked rendering. A builder could inspect the boundary walls and provide further advice.</p> <p>The boundaries incorporate fibrous cement sheeting, which may contain asbestos based materials. See information on Asbestos in the limitations of inspection section above.</p> <p>There are mature trees growing within influencing distance of the house, garage and outbuildings. A tree surgeon will be able to provide further advice.</p> <p>There is cracking to the concrete surface of the yard.</p> <p>There is a timber electrical pylon on the property, with overhead electrical cables traversing the site.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair Category	2
Notes	<p>There is timber cladding to ceiling surfaces. This may represent a fire hazard.</p> <p>The textured finishes may contain asbestos based material. See information on asbestos in the Limitations of Inspection section above.</p>

Internal Walls	
Repair Category	1
Notes	No significant defects evident.

Floors including Sub-floors	
Repair Category	1
Notes	<p>No significant defects evident.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings	
Repair Category	2
Notes	<p>Internal joinery has been subjected to wear and tear commensurate with usage.</p> <p>Fitted kitchen units are worn and dated. It would not be unreasonable to anticipate upgrading by an incoming occupier.</p> <p>Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised safety standards.</p>

Chimney Breasts and Fireplaces	
Repair Category	N/A
Notes	Not applicable.

Internal Decorations	
Repair Category	2
Notes	There are marks and blemishes to the internal decor, which is dated. Redecoration by an incoming occupier could be anticipated.

Cellars	
Repair Category	N/A
Notes	Not applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Electricity	
Repair Category	2
Notes	<p>Please see comments above under 'Garages and Permanent Outbuildings'.</p> <p>The electrical installation is dated including older switches and fuse boxes. There are electrical fittings mounted to timber wall linings. There is an older bakelite light switch in the roof space. An NICEIC/SELECT registered electrician can be engaged to examine the system and implement all necessary upgrading works.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>

Gas	
Repair Category	N/A
Notes	Not applicable.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings	
Repair Category	2
Notes	<p>The en-suite shower room fittings have been painted and are suffering from general wear and tear.</p> <p>Seals around the en suite shower cubicle are discoloured. The sealant/grouting around sanitary fittings and kitchen fittings should be examined regularly together with adjacent floor areas and walls, as such areas are prone to damage by hidden leakage.</p> <p>The bathroom toilet is cracked, whilst there is a mineral build up to the bath.</p> <p>The owner has advised that the shower above the bath is not operational. A plumber could provide further advice.</p> <p>Generally speaking, the sanitary fittings are dated although appear in serviceable condition from our visual inspection. No tests were carried out. Given their age, there should be an expectation of ongoing maintenance and future upgrading.</p> <p>There is visible corrosion to the water supply pump within the subfloor. It is not possible to comment upon the quality or adequacy of the private water supply, but it is assumed that it is wholesome and acceptable for normal consumption patterns. We have not been advised of any supply issues, but further information can be obtained from a suitably qualified specialist contractor.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and Hot Water	
Repair Category	2
Notes	<p>There is corrosion to the radiators.</p> <p>The central heating boiler is of an older type. Informed opinion suggests that many boilers have a life expectancy of between 10 and 20 years. A suitably qualified heating engineer will be able to advise further on repairing requirements or whether replacement is likely to be a more viable solution.</p> <p>It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis. A copy of any relevant documentation in this regard should be obtained.</p> <p>It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.</p> <p>Boilers and central heating systems should be tested and serviced by a Oftec oil registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Drainage	
Repair Category	1
Notes	<p>Drains have not be inspected or tested and covers have not been lifted. There is no obvious surface evidence of chokage or leakage.</p> <p>The owner has advised that the septic tank is registered and has been suitably maintained. A copy of relevant documentation in this regard should be obtained prior to purchase. Regular inspection and maintenance should be anticipated.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	1
Chimney Stacks	N/A
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	1
Windows, External Doors and Joinery	2
External Decorations	1
Conservatories and Porches	N/A
Communal Areas	N/A
Garages and Permanent Outbuildings	2
Outside Areas and Boundaries	2
Ceilings	2
Internal Walls	1
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	2
Chimney Breasts and Fireplaces	N/A
Internal Decorations	2
Cellars	N/A
Electricity	2
Gas	N/A
Water, Plumbing and Bathroom Fittings	2
Heating and Hot Water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

The full extent of the feu could be ascertained with reference to the title deeds.

There are residential housing development plots for sale to both sides of the property. The planning permission for these sites will be available from the Local Authority and could be inspected by a conveyancer who could provide further advice on the nature of these.

The seller has advised that some aspects of the property are commercial in nature and currently have a rateable value, including the workshop. A change of use application to the Local Authority would be required to make the workshop a residential entity and our valuation is reported on the special assumption that such a change of use application would be successful and that the situation was regularised. Additionally, it could be confirmed if the water, drainage, and power services are separate to the main residential property and if they are provided on a residential or commercial basis. A conveyancer could undertake all necessary checks and provide further advice.

The property has been altered in the past, including an extension to from the double garage and the addition of a sun room to the front. The seller has advised that these additions are in excess of twenty years old. Whilst historic it is assumed that all necessary Local Authority and other consents were obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed they meet the standards required by the Building Regulations or are exempt.

Drainage is to a septic tank. The seller has advised that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The seller has advised that water is from a private supply. For the purposes of the valuation, it is assumed that legal, statutory and other standard requirements to facilitate a sale are satisfied.

The property is fitted with photovoltaic panels. All documentation relating to the system should be obtained so that the transfer of ownership can be carried out as part of the conveyancing process. It should be confirmed that there are no outstanding financial liabilities or contracts attached to the property.

We are advised by the seller that timber remedial works have taken place for woodworm in the roof space. They have advised that an appropriate guarantee exists and copies of all relevant documentation can be transferred and retained with the title deeds. This should be confirmed.

Estimated Reinstatement Cost (£) for Insurance Purposes

Five Hundred and Twenty Thousand Pounds:

£520,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

This figure is for the dwelling house and the usual domestic outbuildings only. The figure excludes the large workshop as inclusion of these on a reinstatement basis would result in an extremely high figure which would far exceed their contribution to the market value of the property. Insurance must still be obtained for these buildings, however, possibly on a replacement basis rather than reinstatement, and specialist insurance advice must be obtained in this regard.

Valuation (£) and Market Comments

Two Hundred and Ninety Thousand Pounds:
£290,000

The stated market valuation reflects prevailing market conditions and recent sales evidence.

Against a backdrop of changing economic circumstances and changing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Report author:	Blair Stephen AssocRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors 64 Market Place Inverurie AB51 3XN Tel: 01467 624393 email: inverurieresidential@dmhall.co.uk
Signed:	
Date of report:	6th April 2026

Drewanlea, INSCH, AB52 6QR

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: Drewanlea, INSCH, AB52 6QR

Date of Inspection: 6th April 2026

Reference: 1507967

Location & Description

1. Location:

The property is located in a rural area near the village of Oyne. The property is surrounded by open countryside and farmland. A limited range of facilities and amenities can be found in the immediate area, with a wider range available in the nearby village of Insch and the town of Inverurie.

There is a railway line adjacent to the rear boundary, whilst the B9002 route runs along the front boundary. A degree of noise/vibration from these could be anticipated.

There is a timber electrical pylon on the property, with overhead electrical cables traversing the site.

2. Description:

The property is a detached bungalow.

3. Age:

Originally built around 1970.

4. Main Construction:

Walls: Cavity concrete block.

Roof: Pitched and tiled.

5. Accommodation:

Ground Floor:- Entrance Vestibule, Inner Hallway, Rear Vestibule, Rear Hallway, Bathroom, Shower Room, Living Room, Sun Room, Kitchen, Main Bedroom with Ensuite Shower Room, two further Bedrooms, and Office.

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 145

Gross external floor area: 160

7. Garage and Outbuildings:

Double attached garage and detached workshop.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water:	Yes:	No:	✓
Electricity:	Yes: ✓	No:	
Gas:	Yes:	No:	✓
Drainage:	Yes:	No:	✓

For comments on non-mains services, see section 15.

8a. Heating:

Oil fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: ✓ No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None apparent.

Retention: Yes: No: ✓

Retention amount:

11. Subsidence, Settlement and Landslip:

No obvious evidence of significant movement noted within the limitations of the inspection.

12. General Condition:

The property appeared to be in a condition generally consistent with its age and type. Some works of repair and maintenance are required and a degree of modernisation would be beneficial, including to the outbuildings.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/altered? (If yes, see section 15)

Yes: ✓ No:

Mortgage Valuation Report

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

15. General Remarks:

The full extent of the feu could be ascertained with reference to the title deeds.

There are residential housing development plots for sale to both sides of the property. The planning permission for these sites will be available from the Local Authority and could be inspected by a conveyancer who could provide further advice on the nature of these.

The seller has advised that some aspects of the property are commercial in nature and currently have a rateable value, including the workshop. A change of use application to the Local Authority would be required to make the workshop a residential entity and our valuation is reported on the special assumption that such a change of use application would be successful and that the situation was regularised. Additionally, it could be confirmed if the water, drainage, and power services are separate to the main residential property and if they are provided on a residential or commercial basis. A conveyancer could undertake all necessary checks and provide further advice.

The property has been altered in the past, including an extension to from the double garage and the addition of a sun room to the front. The seller has advised that these additions are in excess of twenty years old. Whilst historic it is assumed that all necessary Local Authority and other consents were obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent, then it has been assumed they meet the standards required by the Building Regulations or are exempt.

Drainage is to a septic tank. The seller has advised that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

The seller has advised that water is from a private supply. For the purposes of the valuation, it is assumed that legal, statutory and other standard requirements to facilitate a sale are satisfied.

The property is fitted with photovoltaic panels. All documentation relating to the system should be obtained so that the transfer of ownership can be carried out as part of the conveyancing process. It should be confirmed that there are no outstanding financial liabilities or contracts attached to the property.

We are advised by the seller that timber remedial works have taken place for woodworm in the roof space. They have advised that an appropriate guarantee exists and copies of all relevant documentation can be transferred and retained with the title deeds. This should be confirmed.

16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject, as always, to the policy of the individual lender.

It is likely that any mortgage application would be dependent on the success of a change of use application, to make current commercial aspects residential entities.

Mortgage Valuation Report

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Two Hundred and Ninety Thousand Pounds: £290,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Five Hundred and Twenty Thousand Pounds: £520,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Blair Stephen AssocRICS 0827422

Date: 13th April 2026

Office Address: DM Hall LLP Chartered Surveyors
64 Market Place
Inverurie
AB51 3XN

Tel: 01467 624393

email: inverurieresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

Energy Performance Certificate (EPC)

Scotland

Dwellings

DREWANLEA, OYNE, INSCH, AB52 6QR

Dwelling type: Detached bungalow
Date of assessment: 06 April 2026
Date of certificate: 15 April 2026
Total floor area: 145 m²
Primary Energy Indicator: 251 kWh/m²/year


Reference number: 5200-0563-0122-5208-1463
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,167	See your recommendations report for more information
Over 3 years you could save*	£1,503	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

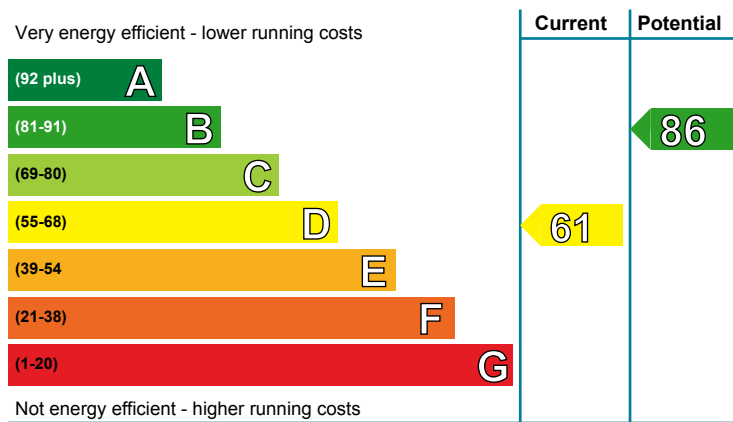


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

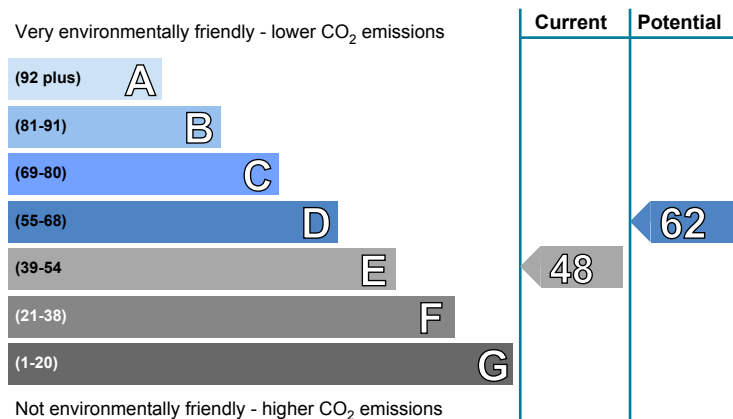

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (48)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£900 - £1,500	£552.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£831.00
3 Low energy lighting	£300 - £350	£114.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
	Flat, insulated	★★★☆☆	★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, oil	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system, plus solar	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 63 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 9.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.









Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£5,997 over 3 years	£4,632 over 3 years	
Hot water	£801 over 3 years	£804 over 3 years	
Lighting	£369 over 3 years	£228 over 3 years	
Totals	£7,167	£5,664	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£900 - £1,500	£184		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£277		
3 Low energy lighting for all fixed outlets	£300 - £350	£38		
4 Wind turbine	£5,000 - £20,000	£755		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

4 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Solar water heating
- Solar photovoltaics

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	24,936.57	N/A	N/A	N/A
Water heating (kWh per year)	2,517.48			

Addendum

The assessment does not include any feed-in tariffs that may be applicable to this property.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Blair Stephen
Assessor membership number:	EES/028024
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	64 Market Place Aberdeenshire Inverurie AB51 3XN
Phone number:	0131 477 6000
Email address:	dmhall@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

