

# Home Report



**28 Isla Place, Mastrick**  
**Aberdeen, AB16 6TE**



**28 Isla Place,**

Mastrick, Aberdeen, AB16 6TE

Price Over

**£115,000**

 **2**
 **1**
 **1**

 **67m<sup>2</sup>**
 **EPC C**
 **Council tax band B**



**Contact solicitor**


Peterkins  
(Property Sales) 100 Union Street  
Aberdeen  
AB10 1QR

01224 428100

[propcen@peterkins.com](mailto:propcen@peterkins.com)

<http://www.peterkins.com>



**Features**  Garden  Off street parking

**Description**

We have the pleasure offering for sale this **two-bedroom mid-terraced dwellinghouse** situated to the north of Aberdeen, close to local amenities. Presented in good condition the property boasts a recently installed kitchen and modern bathroom. The accommodation spans over two floors and comprises of: Hallway with staircase leading to the upper floor; well-proportioned living room with feature electric stove; fitted kitchen with rear garden access. Upper Floor: Two double bedrooms; bathroom with an over bath shower; access to the partly floored loft. Outside there are front and rear gardens together with on street parking. Heating is provided by a gas central heating system and all windows are double glazed. The fitted flooring, light fittings and blinds will be included in the sale.


- Mid-Terraced Two Bedroom Dwellinghouse
- Well-Proportioned Living Room
- Recently Installed Kitchen
- Two Double Bedrooms
- Modern Bathroom with an Over Bath Shower

- Gas Central Heating
- Double Glazing
- Partly Floored Loft
- Front & Rear Gardens
- On Street Parking

**Location** Isla Place is situated within the well-established residential area of Mastrick, which has a wide range of local amenities including shops, a medical centre, nursery, primary and secondary schools all within walking distance. The hospital complex at Foresterhill is also close by and the subjects enjoy easy access to Anderson Drive, and to the business centers to the north and south of the city as well as Aberdeen Airport. The City Centre is a 5/10 minutes' drive from the property and regular public transport is readily available.

## Directions

Travelling north on Anderson Drive turn left at the traffic lights onto the Langstracht. Follow the road for some distance taking a right onto Springhill Road then take the sixth road on the right onto Ythan Road. Isla Place is the next road on the right and number 28 is situated on the left-hand side of the road as indicated by our "For Sale" sign.

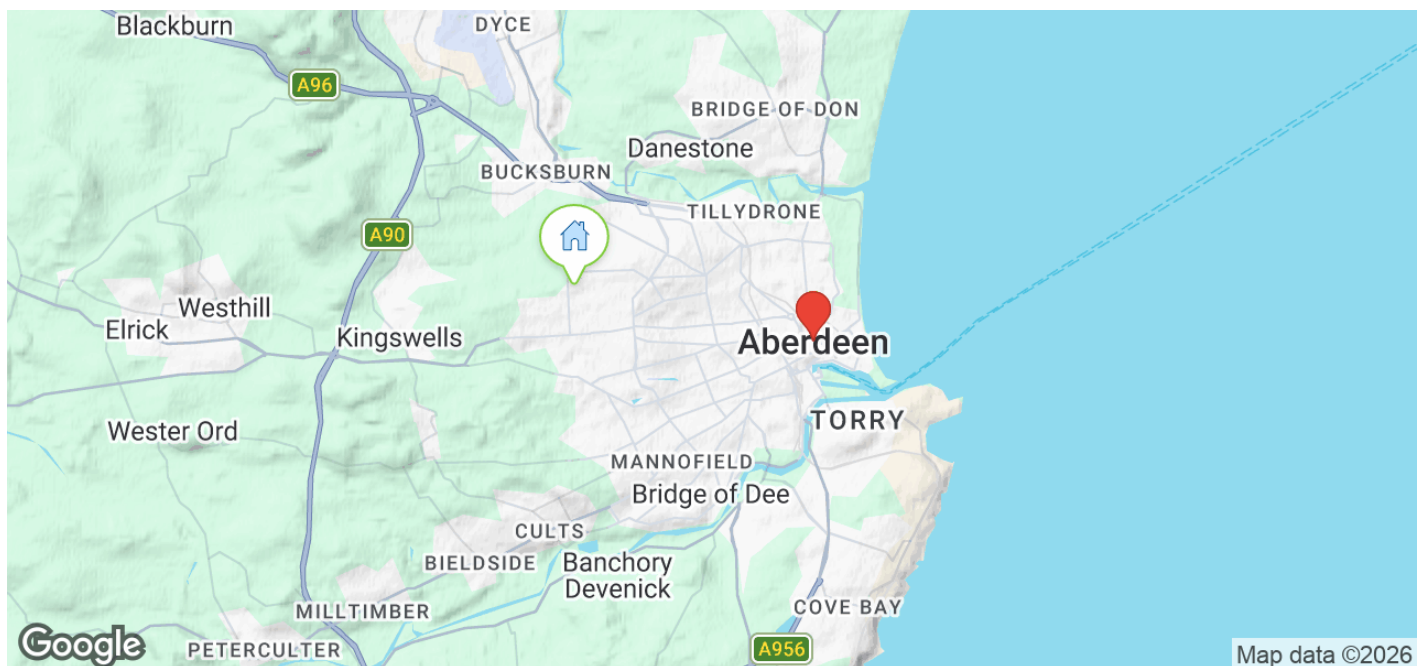

## Accommodation comprises

### (Ground Floor)

**Entrance Hallway:** A part glazed wooden exterior door gives access to the entrance hallway; a carpeted staircase with handrail leads to the upper floor; under stair storage cupboard; electric meter cupboard; window to the front of the house; radiator; wall mounted shelf; smoke detector; pendant light fitting; fitted carpet.

**Living Room:** 5.81m x 3.11m (19'1" x 10'2") approx. Well-proportioned living room with a wonderful dual aspect allowing an abundance of natural light flow into the room; windows to the front and rear of the house; feature electric stove; radiator; smoke detector; two pendant light fitting; fitted carpet.

**Kitchen:** 3.14m x 2.89m (10'4" x 9'6") approx. Recently installed kitchen fitted with an excellent range of dove grey base and wall mounted cabinets complimented by wood effect wood surfaces, upstands and splashbacks; wine rack; 1.5 x stainless steel sink and drainer with a mixer tap; ceramic hob with a glass splashback; built-in oven; window with a built-in extractor fan and roller blind overlooks the rear garden; heat detector; bar style light fitting; laminate flooring; a part glazed wooden exterior door leads out to the rear garden. Note: The fridge/freezer and washing machine will not be included in the sale.

### **(Upper Floor)**

**Upper Hallway:** Access to the partly floored loft via a hatch with "Ramsay" ladder; smoke detector; pendant light fitting; fitted carpet.

**Bedroom 1:** 4.56m x 2.82m (15'0" x 9'3") approx. Generously proportioned double bedroom with two windows to the front of the property fitted with roller blinds; built-in cupboard housing the central heating boiler; radiator; two pendant light fittings; fitted carpet.

**Bedroom 2:** 2.84m x 2.82m (9'4" x 9'3") approx. Spacious second double bedroom with a rear garden aspect; double window; built-in wardrobe with sliding doors; built-in shelved storage cupboard; pendant light fitting; fitted carpet.

**Bathroom:** Modern bathroom fitted with a white three-piece suite comprising of: W.C. with a concealed cistern, wash hand basin set into a vanity unit and bath complete with an over bath mixer shower and shower curtain; marble effect aqua panels around suite; frosted window fitted with a roller blind to the rear of the house; radiator; ceiling light fitting; laminate flooring.

### **(Outside)**

The front garden is mainly laid to grass with a boundary hedge and borders stocked with flowering plants. There is a shared pathway to the side.

The fully enclosed rear garden is also mainly laid to grass with raised beds, a vegetable patch, well-established shrub borders, an outdoor water tap and timber garden shed. A garden gate gives access round the side of the building.

**Parking:** There is on street parking available to the front of the property.

## Photo gallery



**View this property on [aspc.co.uk](https://www.aspc.co.uk):**

<https://www.aspc.co.uk/search/property/441214/28-Isla-Place/Aberdeen/>

The foregoing particulars are being distributed on behalf of the Selling Solicitors by Aberdeen Solicitors' Property Centre Ltd. of 2-10 Holburn Street, Aberdeen, AB10 6BT. Whilst the particulars have been prepared with care and are believed to be accurate, no liability for any errors or omissions therein or the consequences thereof will be accepted by the Selling Solicitors or Aberdeen Solicitors' Property Centre Ltd. © Aberdeen Solicitors' Property Centre and Selling Solicitors.





















## Broadband speed



**Ultrafast**

You can get up to **1800 Mbps** average speed at this postcode.

## Mobile coverage

	Indoor		Outdoor	
	Voice	Data	Voice	Data
	 Likely	 Likely	 Likely	 Likely
	 Limited	 Limited	 Likely	 Likely
	 Likely	 Limited	 Likely	 Likely
	 Likely	 Likely	 Likely	 Likely

## Ofcom

This information is a prediction and actual services may be different depending on my circumstances and precise location. Provided by Ofcom, last retrieved on 16/05/2025. 5G coverage is not included in this data.

The data displayed on broadband coverage availability uses source data from Ofcom. The predicted speeds provided in the API data are provided by the leading UK ISPs. We understand that Ofcom did not receive data for every premise in the UK, and that Ofcom continue to work with industry to fill in the gaps. If no predictions are shown for your address, this does not necessarily mean broadband is not available and we suggest that you check availability on the ISP websites.

The data displayed on mobile coverage availability uses source data made available by Ofcom which is based on data from the mobile operators about how strong they think signal levels are at every location in the UK. Each mobile operator has a slightly different approach to displaying coverage on its own map, including assumptions on the handsets used, levels of call reliability and the expected signal loss when indoors or in car. Because Ofcom brings all mobile operator data together in a single place and holds it to a single, independent standard, the mobile coverage availability information above may display different levels of coverage than those seen on the operators' websites. We would therefore recommend you also check the mobile provider's coverage checker. Mobile coverage data is created by coverage modelling, and since this is based on computer predictions is not error free.

Ofcom update the source data regularly (every month) and the mobile network operators update theirs, but there may be times when the maps are based on slightly different data and therefore show different coverage.

For further information about the Ofcom APIs, read their FAQs available here.

<https://www.ofcom.org.uk/siteassets/resources/documents/research-and-data/broadband-research/api-faqs?v=323603>



# Property Questionnaire

<b>Property address</b>	28 ISLA PLACE, ABERDEEN, AB16 6TE
-------------------------	---

<b>Seller(s)</b>	S Strickland
------------------	--------------

<b>Completion date of property questionnaire</b>	06/08/2025
--	------------

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	<b>Length of ownership</b>	
	How long have you owned the property?	3 years
2.	<b>Council tax</b>	
	Which Council Tax band is your property in? (Please circle)	
	A <b>B</b> C    D    E    F    G    H	
3.	<b>Parking</b>	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	<ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input checked="" type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul>	
4.	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<del>Yes / No /</del> <b>Don't know</b>

# Property Questionnaire

<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<b>Yes / No</b>
<b>6.</b>	<b>Alterations/additions/extensions</b>	
<b>a.</b>	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	<b>Yes / No</b>
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	<b>Yes / No</b>
<b>b.</b>	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<b>Yes / No</b>
	(i) Were the replacements the same shape and type as the ones you replaced?	<b>Yes / No</b>
	(ii) Did this work involve any changes to the window or door openings?	<b>Yes / No</b>
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

# Property Questionnaire

<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<b>Yes / <del>No</del> / <del>Partial</del></b>
<b>b.</b>	When was your central heating system or partial central heating system installed?	New combi boiler Oct 2022
<b>c.</b>	<p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p> <p>OVO</p>	<b>Yes / <del>No</del></b>
<b>d.</b>	When was your maintenance agreement last renewed? (Please provide the month and year).	December 2024 - serviced July 2025
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<b><del>Yes</del> / No</b>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<b><del>Yes</del> / No</b>  <b><del>Yes</del> / No</b>
<b>b.</b>	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<b><del>Yes</del> / No</b>

# Property Questionnaire

10. Services			
a.	Please tick which services are connected to your property and give details of the supplier:		
	<b>Services</b>	<b>Connected</b>	<b>Supplier</b>
	Gas / liquid petroleum gas	✓	Ovo
	Water mains / private water supply	✓	Mains water
	Electricity	✓	Ovo
	Mains drainage	✓	Local authority
	Telephone	—	
	Cable TV / satellite	—	
	Broadband	✓	Vodafone
b.	Is there a septic tank system at your property? If you have answered yes, please answer the two questions below:	<b>Yes / No</b>	
c.	(i) Do you have appropriate consents for the discharge from your septic tank?	<b>Yes / No / Don't know</b>	
d.	(ii) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract:	<b>Yes / No</b>	

# Property Questionnaire

<b>11.</b>	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No / <del>Don't Know</del>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No / <del>Not applicable</del>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<del>Yes</del> / No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Right of access at the rear for emergency exit for mid-terrace residents only</p>	Yes / <del>No</del>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Right of access at the rear for emergency exit for mid-terrace residents only</p>	Yes / <del>No</del>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No
<b>12.</b>	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<del>Yes</del> / No

# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes / No / Don't Know</del></p> <p><del>Yes / No / Don't Know</del></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p><b>13. Specialist works</b></p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p><del>Yes / No</del></p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p><del>Yes / No</del></p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p><del>Yes / No</del></p>

# Property Questionnaire

<b>14. Guarantees</b>							
<b>a. Are there any guarantees or warranties for any of the following:</b>							
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
<b>b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>							
Induction hob guarantee for 2 years and boiler guaranteed for 10years since installation							
<b>c. Are there any outstanding claims under any of the guarantees listed above?</b>						<b>Yes / No</b>	
<b>If you have answered yes, please give details:</b>							
<b>15. Boundaries</b>							
<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b>						<b>Yes / No / Don't know</b>	
<b>If you have answered yes, please give details:</b>							

# Property Questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
	<b>In the past 3 years have you ever received a notice:</b>	
<b>a.</b>	<b>advising that the owner of a neighbouring property has made a planning application?</b>	<b>Yes / No / Don't know</b>
<b>b.</b>	<b>that affects your property in some other way?</b>	<b>Yes / No / Don't know</b>
<b>c.</b>	<b>that requires you to do any maintenance, repairs or improvements to your property?</b>	<b>Yes / No / Don't know</b>
	<b>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b>	

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s):** \_\_\_\_\_

\_\_\_\_\_

**Date:** \_\_\_\_\_

\_\_\_\_\_



# Single Survey

survey report on:

<b>Property address</b>	28 ISLA PLACE, ABERDEEN, AB16 6TE
-------------------------	---

<b>Customer</b>	Ms Samantha Strickland
-----------------	------------------------

<b>Customer address</b>	Per Aberdein Considine + Co, 420-421 Union Street, Aberdeen, AB16 6TE
-------------------------	--

<b>Prepared by</b>	Graham & Sibbald
--------------------	------------------

<b>Date of inspection</b>	1st August 2025
---------------------------	-----------------

**GRAHAM + SIBBALD**

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

# Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

# Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

# Terms and Conditions

*the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

# Single Survey

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The subjects comprise a two storey, mid-terraced house.
<b>Accommodation</b>	Ground Floor: Entrance Hallway, Living Room, Kitchen. First Floor: Landing, Two Bedrooms and Bathroom with W.C.
<b>Gross internal floor area (m<sup>2</sup>)</b>	67 sq.m or thereby.
<b>Neighbourhood and location</b>	The subjects form part of an established Local Authority housing estate, lying to the west of Aberdeen City, where surrounding properties are of a similar style and nature. Locally a fair range of services and facilities are available.
<b>Age</b>	Built circa 1960.
<b>Weather</b>	Dry and cloudy.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  The chimneys are constructed of roughcast brickwork and sealed to the roof with metal flashings.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>  <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b>  The roof over the property is of a pitched design, clad externally in slates with a tiled ridge.

# Single Survey

<b>Roofing including roof space</b>	<p>Access to the roof void is via a hatch and pull down ladder within the first floor landing ceiling. The roof void is part-floored and insulated. Our inspection was limited due to stored items.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Cast iron gutters and downpipes set into the drainage system.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are constructed of cavity blockwork design and finished externally in roughcast. Cavity wall insulation appears to have been installed.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are of timber casement design and are fitted with double glazed units.</p> <p>The front and rear entrance doors are of timber glazed design.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>External timbers are painted.</p>
<b>Conservatories / porches</b>	<p>None.</p>
<b>Communal areas</b>	<p>None.</p>
<b>Garages and permanent outbuildings</b>	<p>None.</p>
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>Located to the front of the property is an area of garden ground which is laid to lawn and shrubs.</p> <p>To the rear of the property is an area of garden ground which is laid to lawn and shrubs.</p> <p>Boundaries are defined by timber fencing and hedging.</p> <p>It is assumed that this is a valid right of access across the neighbouring properties to the rear and side. Details relating to this should be confirmed.</p>

# Single Survey


<b>Ceilings</b>	<b>Visually inspected from floor level.</b> Ceilings are lined in plasterboard.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b> <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b> Internal walls and partitions are lined in plasterboard and plastered on the hard.
<b>Floors including sub floors</b>	Flooring throughout the accommodation is of a suspended timber design. Our inspection of flooring was limited due to fitted floor coverings. No sub-floor inspection was possible.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b> <b>Kitchen units were visually inspected excluding appliances.</b> Internal doors are of timber panel design sitting within painted timber skirtings and facings. The kitchen is fitted with a range of floor and wall units, worktop surfaces and a sink unit.
<b>Chimney breasts and fireplaces</b>	None.
<b>Internal decorations</b>	<b>Visually inspected.</b> Internal decorations are a mixture of painted and papered finishes throughout.
<b>Cellars</b>	None.
<b>Electricity</b>	<b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b> Electricity is from mains public supplies. The meter and consumer unit are located within the hallway cupboard.
<b>Gas</b>	<b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b>

# Single Survey

<b>Gas</b>	<p>Gas is from mains public supplies. The meter is located externally along the front elevation.</p>
<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Water is from mains public supplies. Where seen, internal plumbing is of copper supply pipes and PVC waste pipes.</p> <p>The bathroom is fitted with a white three piece suite.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Heating and hot water are provided by means of a gas fired combination boiler which is wall mounted within the bedroom cupboard and supplies radiators throughout.</p>
<b>Drainage</b>	<p><b>Drainage covers etc were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is assumed to be to a main public sewer.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>New smoke alarm standards were introduced in Scotland in February 2022 and it is likely that some properties may require additional works to meet these standards. In instances where alarms are in place, no tests whatsoever have been carried out and we cannot confirm if the system complies with the most recent regulations. Any potential purchaser should satisfy themselves as to whether the current system meets with regulations or otherwise.</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p>

<b>Any additional limits to inspection</b>	<p>No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.</p> <p>The property was fully furnished at the time of our inspection and the services were not tested.</p> <p>Due to fitted carpets and floor coverings no detailed inspection was possible of the floor timbers and accordingly we cannot guarantee their soundness or otherwise.</p> <p>No access was obtained to sub-floor areas.</p> <p>Our inspection of the roof void was limited due to insulation material and stored items.</p> <p>It is outwith the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.</p> <p>It should be appreciated that the Home Report inspection is a non-disruptive visual inspection of the property as at the date of inspection and that we are unable to inspect parts of the property which are concealed or covered by floor coverings or contents in place at that time. Once vacant, defects may be apparent that could not be detected during our survey. Changing weather conditions can also affect aspects of the property which would not be apparent at the time of inspection.</p>
--	--

## Sectional Diagram showing elements of a typical house

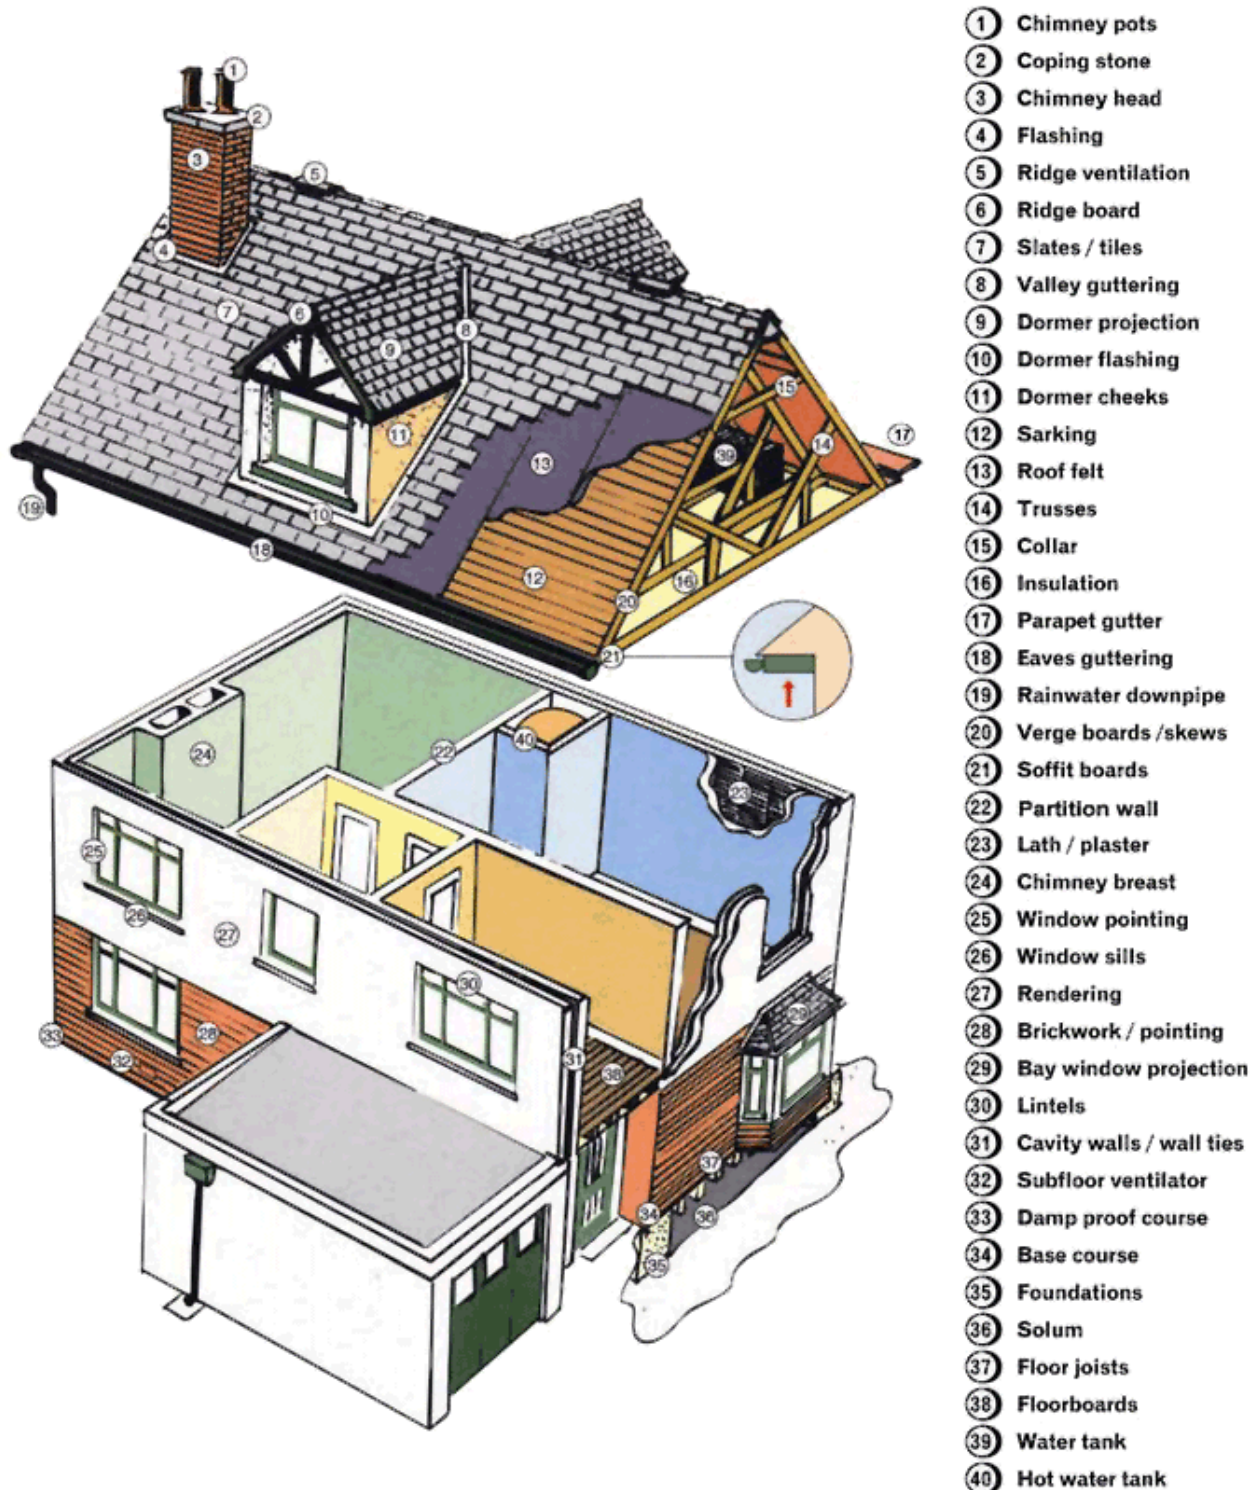


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
<b>Repair category</b>	1
<b>Notes</b>	At the time of our inspection there was no evidence of significant structural movement noted to affect the property within the limits of our inspection.

 Dampness, rot and infestation	
<b>Repair category</b>	2
<b>Notes</b>	Evidence of wood bore infestation was noted to timbers within the roof void area. It is recommended that prior to purchase, a reputable timber/damp specialist is instructed to carry out an inspection of the property with any required remedial works carried out.

 Chimney stacks	
<b>Repair category</b>	2
<b>Notes</b>	Areas of weathering and cracking were noted to the roughcast of the chimney. Future repairs will likely be required.

 Roofing including roof space	
<b>Repair category</b>	2
<b>Notes</b>	<p>The roof covering is of an age where ongoing repair and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected lifespan.</p> <p>Evidence of wood bore infestation was noted to timbers within the roof void.</p>



## Rainwater fittings

<b>Repair category</b>	2
<b>Notes</b>	The rainwater fittings are subject to corrosion and future repairs will likely be required.



## Main walls

<b>Repair category</b>	2
<b>Notes</b>	Areas of weathering were noted to the roughcast. Cracking was noted along the rear elevation. The main walls will require a degree of regular on-going maintenance.



## Windows, external doors and joinery

<b>Repair category</b>	2
<b>Notes</b>	<p>The windows and external doors were not all fully tested and opened. It should be appreciated that some defects may only be evident during certain weather conditions.</p> <p>The windows are of an older design and will require an increased degree of maintenance. External timbers to the frames were noted to be weathered.</p>



## External decorations

<b>Repair category</b>	2
<b>Notes</b>	<p>The external decorations are generally in fair order. Regular repainting will be required if these areas are to be maintained in satisfactory condition.</p> <p>External timbers were noted to be weathered and requiring repainting in places.</p>



## Conservatories/porches

<b>Repair category</b>	-
<b>Notes</b>	N/A



## Communal areas

<b>Repair category</b>	-
<b>Notes</b>	N/A



## Garages and permanent outbuildings

<b>Repair category</b>	-
<b>Notes</b>	N/A



## Outside areas and boundaries

<b>Repair category</b>	1
<b>Notes</b>	<p>The boundaries appear reasonably well defined and are in adequate condition. Regular maintenance will be required. You should verify with your conveyancer the extent of the boundaries attaching to the property.</p> <p>Weathering was noted to the timber fencing.</p>



## Ceilings

<b>Repair category</b>	2
<b>Notes</b>	Fibreboard linings were noted to the ceiling area above the stairs. This may pose a risk in the event of a fire.



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	Within the limits of our inspection these generally appeared in fair condition consistent with age.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	No significant defects were evident to the flooring at surface level, within the limitations imposed by fully fitted floor coverings.



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	The internal joinery and kitchen fittings are generally maintained.



## Chimney breasts and fireplaces

<b>Repair category</b>	-
<b>Notes</b>	N/A



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	The property is generally well presented. A number of visible taping joints were noted.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	N/A



## Electricity

<b>Repair category</b>	1
<b>Notes</b>	The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every five years and on a change of ownership. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.



## Gas

<b>Repair category</b>	1
<b>Notes</b>	In the interest of safety all gas appliances should be checked by a Gas Safe Registered Engineer.



## Water, plumbing and bathroom fittings

<b>Repair category</b>	1
<b>Notes</b>	<p>It should be appreciated that concealed areas beneath and around baths and shower trays could not be inspected. Water spillage in these areas can result in dampness/decay and no comment can be made on inaccessible areas.</p> <p>The sanitary fittings appear in serviceable condition from our visual inspection. No tests were carried out.</p>



## Heating and hot water

<b>Repair category</b>	1
<b>Notes</b>	It is assumed that the central heating system, inclusive of the fluing and ventilation, has been installed in accordance with the manufacturer's specification and guidance, by a qualified heating specialist, and that any repairs or upgrades also comply with all relevant regulations.



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

<b>1. Which floor(s) is the living accommodation on?</b>	Ground and First
<b>2. Are there three steps or fewer to a main entrance door of the property?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>3. Is there a lift to the main entrance door of the property?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>4. Are all door openings greater than 750mm?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>5. Is there a toilet on the same level as the living room and kitchen?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>6. Is there a toilet on the same level as a bedroom?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
<b>7. Are all rooms on the same level with no internal steps or stairs?</b>	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
<b>8. Is there unrestricted parking within 25 metres of an entrance door to the building?</b>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list, alterations noted at the time of our inspection include the inclusion of the former coal cellar within the internal accommodation. We have not been advised of when these works were carried out.

Confirmation should be ascertained that all appropriate Local Authority consents and approvals have been obtained for the internal alterations and extensions to form the property in its present layout. It is assumed that all alterations, additions and/ or extensions to the property have been received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificates) approvals and that documentation for such is available.

It is assumed that this is a valid right of access across the neighbouring properties to the rear and side. Details relating to this should be confirmed.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

### Estimated reinstatement cost for insurance purposes

It is assumed that insurance cover is obtainable on normal terms. The guidance figure is the estimate of costs for reinstating the subjects as at the date of inspection based on information provided by the Building Cost Information Service (BCIS). It is recommended that this figure is kept under regular review to ensure that you have adequate insurance cover. We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £185,000 (ONE HUNDRED AND EIGHTY FIVE THOUSAND POUNDS STERLING).

### Valuation and market comments

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £125,000 (ONE HUNDRED AND TWENTY FIVE THOUSAND POUNDS STERLING).

**Signed**

Security Print Code [533267 = 6734 ]  
Electronically signed

**Report author**

Andrew Sinclair

# Single Survey

<b>Company name</b>	Graham & Sibbald
<b>Address</b>	21 Carden Place, Aberdeen, AB10 1UQ
<b>Date of report</b>	7th August 2025

# Mortgage Valuation Report

## GRAHAM + SIBBALD

### Property Address

Address 28 ISLA PLACE, ABERDEEN, AB16 6TE  
Seller's Name Ms Samantha Strickland  
Date of Inspection 1st August 2025

### Property Details

Property Type  House  Bungalow  Chalet  Purpose built maisonette  
 Coach  Studio  Converted maisonette  Purpose built flat  
 Converted flat  Tenement flat  Flat over non-residential use  Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

### Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

### Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

### Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

None.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  
 Solid  Cavity  Steel frame  Concrete block  Other (specify in General Remarks)

Roof  Tile  Slate  Asphalt  Felt  
 Lead  Zinc  Artificial slate  Flat glass fibre  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No  
If Yes, is this recent or progressive?  Yes  No  
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No  
If Yes to any of the above, provide details in General Remarks.

## Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None  
Electricity  Mains  Private  None  
Central Heating  Yes  Partial  None

Water  Mains  Private  None  
Gas  Mains  Private  None

Brief description of Central Heating:

Gas fired boiler to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Agricultural land included with property  Ill-defined boundaries  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

The subjects form part of an established Local Authority housing estate, lying to the west of Aberdeen City, where surrounding properties are of a similar style and nature. Locally a fair range of services and facilities are available.

At the time of inspection, the property was found to be generally maintained. On-going maintenance will be required to the external fabric of the building.

The valuation is made on the assumption that any alterations that may have been carried out to the property satisfy all relevant legislation and have full certification where appropriate. While not necessarily an exhaustive list, alterations noted at the time of our inspection include the inclusion of the former coal cellar within the internal accommodation. We have not been advised of when these works were carried out.

Confirmation should be ascertained that all appropriate Local Authority consents and approvals have been obtained for the internal alterations and extensions to form the property in its present layout. It is assumed that all alterations, additions and/ or extensions to the property have been received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificates) approvals and that documentation for such is available.

It is assumed that this is a valid right of access across the neighbouring properties to the rear and side. Details relating to this should be confirmed.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

## Essential Repairs

None.

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

In our opinion the property forms suitable security for loan purposes subject to the specific lender's criteria which may vary.

## Valuations

Market value in present condition £ 125,000  
Market value on completion of essential repairs £   
Insurance reinstatement value £ 185,000  
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)  
Is a reinspection necessary?  Yes  No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £   
Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed Security Print Code [533267 = 6734 ]  
Electronically signed by:-  
Surveyor's name Andrew Sinclair  
Professional qualifications MRICS  
Company name Graham & Sibbald  
Address 21 Carden Place, Aberdeen, AB10 1UQ  
Telephone 01224 625024  
Fax  
Report date 7th August 2025

# Energy Performance Certificate (EPC)

# Scotland

Dwellings

28 ISLA PLACE, ABERDEEN, AB16 6TE

**Dwelling type:** Mid-terrace house  
**Date of assessment:** 01 August 2025  
**Date of certificate:** 06 August 2025  
**Total floor area:** 67 m<sup>2</sup>  
**Primary Energy Indicator:** 213 kWh/m<sup>2</sup>/year


**Reference number:** 0190-2239-9280-2505-1061  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£2,991</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£402</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

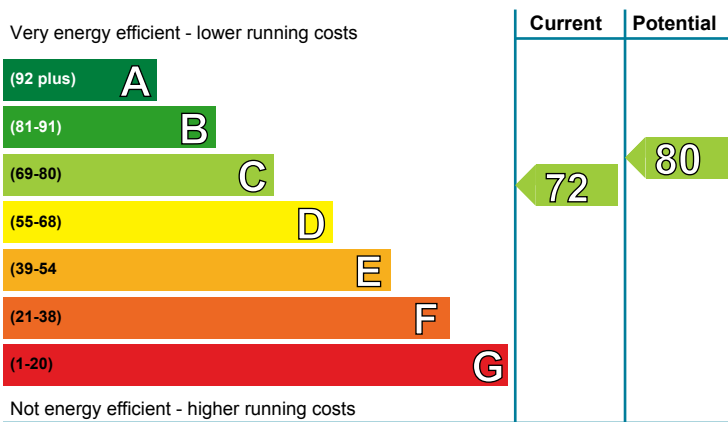


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (72)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

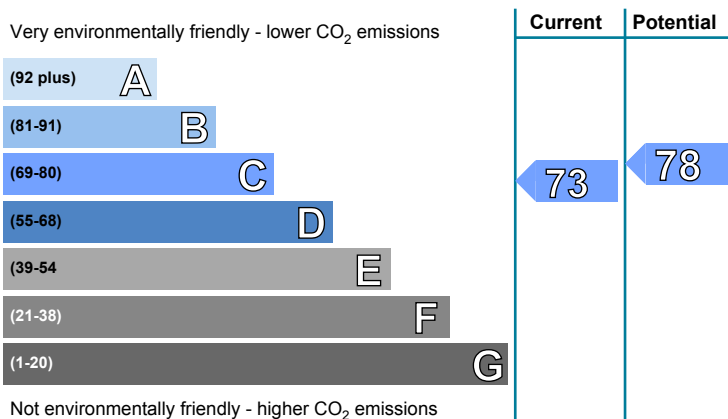

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (73)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£900 - £1,200	£195.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£207.00
3 Solar photovoltaic (PV) panels	£8,000 - £10,000	£582.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	★★★★☆	★★★★☆
Roof	Pitched, 50 mm loft insulation	★★☆☆☆	★★☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 39 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.







### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,334 over 3 years	£1,932 over 3 years	
Hot water	£513 over 3 years	£513 over 3 years	
Lighting	£144 over 3 years	£144 over 3 years	
<b>Totals</b>	<b>£2,991</b>	<b>£2,589</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£900 - £1,200	£65		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£69		
3 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£194		

### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).



## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,931.9	N/A	N/A	N/A
Water heating (kWh per year)	2,305.12			

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Andrew Sinclair
Assessor membership number:	EES/022131
Company name/trading name:	Graham & Sibbald
Address:	21 Carden Place Aberdeen AB10 1UQ
Phone number:	01224 625024
Email address:	<a href="mailto:aberdeen@g-s.co.uk">aberdeen@g-s.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT

